

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Southeast corner of North and Brainard; front and north sidewalks; privacy plantings

COA DATE

COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE

DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTOID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES WINDOW CONFIG

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES WINDOW CONFIG

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Southwest corner of Brainard and Benton; front and north sidewalks; partial side driveway; rear fencing; south side yard; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 10

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Hipped roof w/ modillion cornice; center full height portico w/ massive paired stone Ionic columns and triangular pediment; stone entry w/ garland and round arch multi-light transom; stone corner quoins; round arch 2nd story window openings with voisoirs; red face brick exterior with buff brick base

Historic Information

[from A GUIDE TO CHICAGO'S HISTORIC SUBURBS, p. 408]

“This relatively small but quite massive structure shows that, at North Central College, the library was a serious place. It has pairs of Ionic columns flanking the doorway and supporting the pediment which is made of sheet metal, as is the cornice. In the block to which that frontispiece is attached are pairs of arched windows with the extrados of the arch traced in limestone, corresponding to the frontispiece and to the quoins and mud sill of the brick structure.”

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS ****GUIDE TO CHICAGO'S HISTORIC SUBURBS, P. 408**.** After being vacant for many years, the building was rehabbed and re-opened in 1986 (NHS file)

LANDSCAPE Northeast corner of Brainard and Benton; at southwest corner of main campus block of North Central College; front, side, and rear sidewalks; building on slight rise; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR

ROOF MATERIAL

DATE SOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees; rear fencing

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 11

STREET S. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Flared hipped roof with overhanging eaves; front and north side gables w/ deep cornice returns; historic hipped porch w/ rounded columns on concrete block piers (probably an historic alteration); historic leaded glass double and single hung windows; north side three-sided window bay with flared roof and leaded glass upper sashes in windows

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 15

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Front porch addition (historic--c. 1910); 1/1 replacement front windows (historic); 2 story front gable north/rear section may be early addition; 4/4 replacement windows on N. side (historic); rear deck add. (not historic); S. covered walkway; 1 story south/rear add. (c. 1950); replacement wood siding and fixed shutters (not historic); Aluminum siding under eaves

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 15

STREET S. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Hipped roof with front gable; 2 story 3-sided front window bay with center leaded glass windows; full front hipped porch w/ classical columns on shingled knee wall; north side rounded oriel bay with conical roof; historic 1/1 wood & leaded glass windows; north and south hipped dormers

Historic Information

House received plaque from the Naperville Heritage Society in 2006. The house was built in 1908 as a parsonage for Second Evangelical Church. The Jaeck family purchased it from the church and later deeded it to their daughter and son-in-law, Minnie & William C. Scherer.

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

BEGINYEAR NO OF STORIES

OTHER YEAR

ROOF TYPE

ROOF MATERIAL

FOUNDATIONSOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

City of NAPERVILLE
ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY
CONTINUATION SHEET

STREET # 21

STREET S. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Historic Information

[taken from address files at Naperville Heritage Society Research Room]

Lot 4 Block 7 Delcar Sleight's Addition

From Samuel Barr to Leah Stone (WD) dated 10/4/1872---\$350.00

From Susan Stoner to Laura Ebright (WD) dated 6/13/1917--\$2,400.00

From Laura Ebright to George Koob, Jr. (WD) 1/24/1920--\$4,500.00

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

BEGINYEAR NO OF STORIES

OTHER YEAR

ROOF TYPE

ROOF MATERIAL

FOUNDATIONSOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME Stoner, Leah House

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS According to title research on file at Naper Settlement, house was probably built in mid-1870s. See continuation sheet.

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE



DIGITAL PHOTO ID \Images\brainard021s.jpg

DIGITAL PHOTO ID3 \Images\brainard021s(3).jpg

DIGITAL PHOTO ID2 \Images\brainard021s(2).jpg

DIGITAL PHOTO ID4 \Images\brainard021s(4).jpg

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES WINDOW CONFIG

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear driveway; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE
ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY
CONTINUATION SHEET

STREET # 30

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

North section is original building, middle section is either original or very early addition (but has been recently altered and added to), south section is historic (c. 1890) addition; mansard roof with modillion cornice and paired scrolled brackets on original, north section; projecting square bay in center of original building (north section) with copper pinnacle on roof; rusticated limestone exterior; round arch and segmental arch window openings; flat arch lintels on first story, flanged segmental arch dormers

Alterations

Original raised front entry was in center of north section—steps to entry have been removed, and entry has been closed with balcony; entry on south (c. 1890) addition was also raised, but has been filled in with ground level window (not historic); top two stories (including mansard roof) of center section are addition from 1998 renovation; south section originally had hipped roof—mansard is an historic alteration; vinyl replacement windows in original openings; replacement entry doors in middle section (probably in altered openings); below grade entry doors on east elevation; elevated patio addition to north elevation

Historic Information

From the DuPage County Cultural and Historical Inventory (1993-1996):

“Old Main was the original building of the present campus of North Central College. It was built in 1870 [note—this date conflicts with the plaque on the building that says “class of 1879”] after the college was moved from Plainfield to Naperville. The college was founded by the Evangelical Association. This one building once held all the classrooms, a chapel, meeting halls, a men’s dormitory, library, and an apartment. The building was originally heated by fireplaces and stoves. When the south wing was added in 1891, a heating system was installed. A music department and women’s dormitory were also later added. In 1873, the cost of attending college here was approximately \$50, including tuition, room, board, fuel, and laundry.”

Building was renovated in 1998---[from THE SUN, 10/9/1998, p. 4]:

“The ‘new’ Old Main has an additional 5,000 square feet, provided by two floors built to connect the north and south towers....At one time, Old Main was North Central College. Built in 1870, when the college moved to Naperville from Plainfield, Old Main was constructed without the benefit of blueprints. To get from one tower to the other, you had to go down steep stairs to the bottom of the building and back up again. ‘It was a building with character that became a character,’ Wilde said. People lived, worked and attended classes in the old building.”

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

BEGINYEAR NO OF STORIES

OTHER YEAR

ROOF TYPE

ROOF MATERIAL

FOUNDATIONSOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME Heidner, Rev. House

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO Heidner was professor of German languages at North Central College. See continuation sheet.

PERMITS Sanborns dating from 1898 show the rear north and south porches in essentially the same configuration as they are now.

LANDSCAPE Northeast corner of Brainard & Van Buren; front and south sidewalks; rear alley; large north side yard; mature trees

COA DATE

COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE



DIGITAL PHOTO ID \Images\brainard 030s.jpg

DIGITAL PHOTO ID3 \Images\brainard030s (4).jpg

DIGITAL PHOTO ID2 \Images\brainard 030s(5).jpg

DIGITAL PHOTOID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME Stephens, Mathias A. House

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER Stephens, Mathias A.

ARCHITECT SOURCE

HISTORIC INFO Stephens, a carpenter, bought the lot in 1871 and built the house in 1873. See continuation sheet.

PERMITS Sanborn maps dating from 1893 show rear gabled 2 story section of house; Sanborns from 1893 through 1943 show bldg w/ full front porch.

LANDSCAPE Northwest corner of Van Buren and Brainard; front and south sidewalks; wrought iron fence; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE



DIGITAL PHOTO ID \Images\brainard031s.jpg

DIGITAL PHOTO ID3 \Images\brainard031s(3).jpg

DIGITAL PHOTO ID2 \Images\brainard031s(2).jpg

DIGITAL PHOTO ID4 \Images\brainard031s(4).jpg

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME Kroehler, Peter Kenneth
Science Center

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on east side of Brainard, at west edge of main campus block; front façade facades east; walkways; mature trees; courtyard east of building

COA DATE

COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE



DIGITAL PHOTO ID \Images\brainard040n.jpg

DIGITAL PHOTO ID3 \Images\brainard040n(3).jpg

DIGITAL PHOTO ID2 \Images\brainard040n(2).jpg

DIGITAL PHOTO ID4 \Images\brainard040n(4).jpg

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION

HISTORIC FUNCTION

INTEGRITY

REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

NO OF STORIES

BEGINYEAR

ROOF TYPE

OTHER YEAR

ROOF MATERIAL

DATESOURCE

FOUNDATION

WALL MATERIAL (current)

PORCH

WALL MATERIAL 2 (current)

WINDOW MATERIAL

WALL MATERIAL (original)

WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO Former site of "Three Elms," the home of Henry Rassweiler, 2nd president of North Central College. The house was demolished in 1971.

PERMITS

LANDSCAPE

COA DATE


COA DECISION

PREPARER Lara Ramsey

PREPARER ORGANIZATION GRANACKI HISTORIC CONSULTANTS

SURVEYDATE 11/27/2007

SURVEYAREA NAPERVILLE

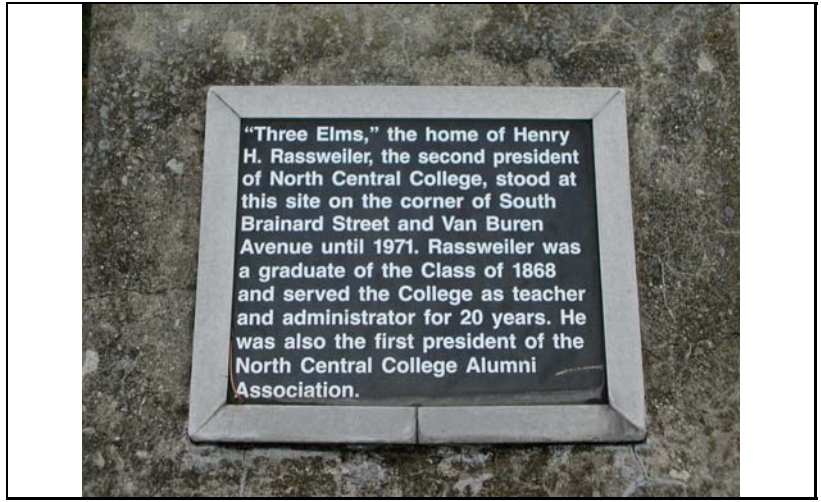

DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTOID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Southwest corner of Brainard and Van Buren; front and north sidewalks; rear driveway; similar setbacks; mature trees

COA DATE


COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; side driveway; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; rear wood fence; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; side driveway; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 120-122

STREET S. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Hipped roof with larger paired brackets interspersed with smaller single brackets; front façade w/ elaborate incised wood door and windows surrounds w/ center keystones; simpler classical lintels on side windows; historic 2/2 vertical wood windows with flattened arches on upper sash; 1st story front window bay with scrolled brackets and piers; historic double wood front door

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

BEGINYEAR NO OF STORIES

OTHER YEAR ROOF TYPE

DATESOURCE ROOF MATERIAL

FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO According to NR nomination, this house was occupied for many years by the Hammerschmidt family, prominent in the local quarrying business. Plaque says the family bought it in 1902.

PERMITS Sanborn maps indicate that the rear/north addition and enclosure/extension of S. porch occurred after 1943.

LANDSCAPE Midblock on east side of residential street; front sidewalk; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE
ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY
CONTINUATION SHEET

STREET # 125

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Alterations

Replacement windows in original openings (not historic); fixed shutters (not historic); replacement siding and shingles (historic); front porch railings & posts replaced, and porch possibly extended; rear/s. porch enclosed (not historic); replacement door in ell; extra door on S. side of gable bay

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES WINDOW CONFIG

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS 1898 Sanborn map (Sheet 3) shows 1.5 story NE corner porch and a second S. porch.

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE
ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY
CONTINUATION SHEET

STREET # 135

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Hipped roof with paneled frieze; historic 2/2 flattened arch wood windows on front and south elevations with elaborate incised wood surrounds & center keystones; double entry doors with flattened arch transom and incised wood surround; oval north window; two story north bay with 1/1 wood windows; two story south side square bay; three-sided south window bay with historic 1/1 windows

Historic Information

[from A GUIDE TO CHICAGO'S HISTORIC SUBURBS, p. 402]

“...this is a good example of a cubic, Italianate building from the 1870s. Especially notable are the window surrounds which have feet and shoulders and nice incising in the upper parts and the keystone.”

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; side driveway; large lot; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTOID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

SIGNIFICANT FEATURES

ALTERATIONS

WINDOW CONFIG

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

City of NAPERVILLE

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 145

STREET N. BRAINARD STREET

ADDITIONAL PHOTOS OR INFORMATION

Front gambrel roof with cornice returns; shingle siding; rounded vergeboard & pent enclosure under gable (south side bay has identical gable); cutaway corners on front bay; inset front entry porch with classical corner column; 3-sided south 1st story window bay; hipped north dormer windows; historic 1/1, leaded glass/1; and multi-light wood windows

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; rear driveway; front sidewalk; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Southwest corner of School and Brainard; front and north sidewalks; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Northwest corner of Brainard and School; front and south sidewalks; oversized lot; wrought iron fence; rear alley; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; large lot; mature trees; rear alley

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR

ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS NO OF STORIES

BEGINYEAR ROOF TYPE

OTHER YEAR ROOF MATERIAL

DATESOURCE FOUNDATION

WALL MATERIAL (current) PORCH

WALL MATERIAL 2 (current) WINDOW MATERIAL

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original) WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4

STREET #

DIRECTION

STREET

SUFFIX

PIN

LOCAL SIGNIFICANCE RATING

POTENTIAL IND NR? (Y or N)

Contributing to a NR DISTRICT?

Contributing secondary structure?

Listed on existing SURVEY?



GENERAL INFORMATION

CATEGORY CURRENT FUNCTION

CONDITION HISTORIC FUNCTION

INTEGRITY REASON for SIGNIFICANCE

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL CLASSIFICATION PLAN

DETAILS

BEGINYEAR NO OF STORIES

OTHER YEAR

ROOF TYPE

ROOF MATERIAL

FOUNDATION

DATE SOURCE PORCH

WALL MATERIAL (current) WINDOW MATERIAL

WALL MATERIAL 2 (current)

WALL MATERIAL (original) WINDOW MATERIAL

WALL MATERIAL 2 (original)

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT FEATURES

ALTERATIONS

HISTORIC INFORMATION

HISTORIC NAME

COMMON NAME

COST

ARCHITECT

ARCHITECT2

BUILDER

ARCHITECT SOURCE

HISTORIC INFO

PERMITS

LANDSCAPE Southwest corner of North and Brainard; front and north sidewalks; rear alley; similar setbacks; mature trees

COA DATE

COA DECISION

PREPARER

PREPARER ORGANIZATION

SURVEYDATE

SURVEYAREA



DIGITAL PHOTO ID

DIGITAL PHOTO ID3

DIGITAL PHOTO ID2

DIGITAL PHOTO ID4