ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	226	
DIRECTION	Ν	
STREET	WRIGHT	
SUFFIX	ST	
PIN	0818143001	
LOCAL SIGNIFICANCE		
RATING	S	the factor of the second se
POTENTIAL IND NR? (Y or N)	Ν	
Contributing to a NR DISTRICT?	С	
Contributing second	dary structure? C	
Listed on existing SURVEY?	Local District; NR District	
		GENERAL INFORMATION

CATEGORY	building	CURRENT FUNCTION	ON Domestic - single dwelling
CONDITION	good	HISTORIC FUNCTI	ON Domestic - single dwelling
INTEGRITY	minor alterations and addition(s)	SIGNFICANCE	Intact early 20th-century Colonial Revival, featuring a broad front porch with classical columns on a concrete block base.
SECONDARY STRUCTURE	Detached garage		

ARCHITECTURAL DESCRIPTION

ARCHITECTURA	т			
CLASSIFICATIO		Revival	PLAN	rectangular
			NO OF STORIES	2.5
DETAILS			ROOF TYPE	Hipped
BEGINYEAR	1904		ROOF MATERIAL	Asphalt - shingle
OTHER YEAR			FOUNDATION	Concrete - block
DATESOURCE	Owner		FOUNDATION	CONCIERE - DIOCK
	-		PORCH	Full front
WALL MATERIA		Aluminum	WINDOW MATERIA	L Wood
WALL MATERIA	L 2 (current)		WINDOW MATERIA	L Leaded glass
WALL MATERIA	L (original)	Wood		L Leaded glass
			WINDOW TYPE	double hung/single hung
WALL MATERIA	L 2 (original)		WINDOW CONFIG	1/1; multi/1
	Hipped roof w/ front hipped dormer; full front porch with classical columns on concrete block piers; 3-sided window bay under porch; historic wood door; historic; multi-light/1; 1/1 and leaded glass windows on front & south elevations			
	Aluminum siding (not historic); 1 story rear add. (1960s); rear deck add. (1987); replacement windows in original openings on S. elevation (not historic); N. side doorway downsized to window, w/ at grade doorway installed (not historic)			

HISTORIC NAME	Garment House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
INFO	See continuation sheet for historic postcard of house and owner information.
PERMITS	
LANDSCAPE	Southeast corner of Wright and North; double lot; front and north sidewalks; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
226 N WRI	GHT

DIGITAL	\Images\wright22	DIGITAL
PHOTO ID	6n.jpg	PHOTO ID3
DIGITAL	\Images\wright22	DIGITAL
PHOTO ID2	6n(2).jpg	PHOTOID4

\Images\wright226n(3).jpg
\Images\wright226n(4).jpg

STREET #	131		A states		
DIRECTION	Ν				1 and the second
STREET	WRIGHT				A PART AND A
SUFFIX	ST				
PIN	0818308012				1
LOCAL SIGNIFICANCE RATING	С				
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	С				
Contributing second	dary structure	? C	the state of the s		
Listed on existing SURVEY?	Local District;	NR District			
			GENERAL INFO	RMATION	
CATEGORY bu	iilding		CURRENT FUNCTION	DN Domestic - single dwell	ing
CONDITION ex	cellent		HISTORIC FUNCTION	ON Domestic - single dwell	ing
INTEGRITY minor alterations and addition(s) REASON for SIGNFICANCE					
SECONDARY STRUCTURE	Detached gar	age			
			ARCHITECTURAI	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION		Foursquare		PLAN	rectangular
	, incritati	rouioquaio		NO OF STORIES	2.5
DETAILS	c. 1915			ROOF TYPE	Hipped
BEGINYEAR	C. 1915			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR	Survoyor			FOUNDATION	Concrete - block
DATESOURCE	Surveyor	Wood		PORCH	Full front
WALL MATERIA		vvoou		WINDOW MATERIA	L Wood
WALL MATERIA		Wood		WINDOW MATERIA	L Stained glass
WALL MATERIA		WOOU		WINDOW TYPE	Double & single hung/case
WALL MATERIA	u 2 (original)			WINDOW CONFIG	1/1; 1-light
	Hipped roof wit double hung wi		s under eaves and front hip	ped dormer; curved knee w	all of front porch; historic 1/1
			n windows (historic alteratio behind porch; wrought iron		have been raised (not

2
Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
131 N WRI	GHT

	\lma 1n.j
DIGITAL	\lma
PHOTO ID2	1n(2

)	\Images\wright13 1n.jpg	DIGITAL PHOTO ID3
2	\Images\wright13 1n(2).jpg	DIGITAL PHOTOID4

\Images\wright131n(3).jpg
\Images\wright131n(4).jpg

STREET #	132		-	· F		~	Propagat 1
DIRECTION	S						1
STREET	WRIGHT				iii./		S THE
SUFFIX	ST			A REAL PROPERTY AND			
PIN	0818323004		100	17		TRACK CANON	
LOCAL SIGNIFICANCE RATING	S			been state			
POTENTIAL IND NR? (Y or N)	Ν						
Contributing to a NR DISTRICT? Contributing secon	C dary structure	? C					
Listed on existing SURVEY?	IHSS (O); Lo	cal District; NR		R		, i	
GENERAL INFORMATION							
CATEGORY bu	uilding			CURRENT FUNCT	ION	Domestic - single dwelli	ng
CONDITION ex	cellent			HISTORIC FUNCT	ION	Domestic - single dwelli	ng
INTEGRITY minor alterations REASON for SIGNFICANCE SIGNFICANCE Unusual, early example of Dutch Colonial Revival architecture, with broad side-gambrel roof and classical front porch.							
SECONDARY STRUCTURE	Detached ga	rage					
			AR	CHITECTURA	LD	ESCRIPTION	
ARCHITECTURA CLASSIFICATION		Ionial Revival				PLAN	rectangular
						NO OF STORIES	2
DETAILS	- 1005					ROOF TYPE	Side gambrel
BEGINYEAR	c. 1905					ROOF MATERIAL	Asphalt - shingle
OTHER YEAR						FOUNDATION	Stone
DATESOURCE	NHS add					PORCH	Full front
WALL MATERIA		Wood				WINDOW MATERIA	
WALL MATERIA	L 2 (current)	aluminum				WINDOW MATERIA	
WALL MATERIA	L (original)	Wood				WINDOW TYPE	Double hung/single hung
WALL MATERIA	L 2 (original)					WINDOW CONFIG	3/1; 1/1

Broad side gambrel roof with cornice returns; front gambrel centered along front façade; 3-sided south side window bay with leaded glass windows
Replacement 3/1 wood windows in original openings (historic1920s); replacement front porch (historic); Aluminum awning on front 2nd story window (not historic)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
INFO durin was	ograph of stenciling uncovered g rehab work says that house built in 1905no other information bstantiate that date.
PERMITS	
Chi	theast corner of Wright and cago; oversized lot; front and th sidewalks; mature trees
-	
COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE

132 S WRIGHT





DIGITAL	\Images\wright13	DIGITAL	\Images\wright132s(3
PHOTO ID	2s.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright13	DIGITAL	\Images\wright132s(4
PHOTO ID2	2s(2).jpg	PHOTOID4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	135						
DIRECTION	Ν		14.1		5 6	alt	2
STREET	WRIGHT		The second				
SUFFIX	ST		14				
PIN	0818308011		2				
LOCAL SIGNIFICANCE RATING	С			Contraction of the second	1500	a .	
POTENTIAL IND NR? (Y or N)	Ν			STREET,		135	
Contributing to a NR DISTRICT?	С			erai			
Contributing secon	dary structure	? C					
Listed on existing SURVEY?	Local District;	NR District		Contractor			
GENERAL INFORMATION							
CATEGORY bu	uilding			CURRENT FUNCTION	ON	Domestic - single dwelli	ng
CONDITION ex	kcellent			HISTORIC FUNCTION	ON	Domestic - single dwelli	ng
INTEGRITY m	inor alterations	and addition(s)		REASON for SIGNFICANCE			
SECONDARY STRUCTURE	Detached gar	age					
			AR	CHITECTURAI	L DI	ESCRIPTION	
ARCHITECTURA CLASSIFICATION		Foursquare				PLAN	rectangular
DETAILS		•				NO OF STORIES	2.5
BEGINYEAR	c. 1910					ROOF TYPE	Hipped
OTHER YEAR	0. 1910					ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor					FOUNDATION	Concrete - block
		Wood				PORCH	Full front
WALL MATERIA		wood				WINDOW MATERIA	L Wood
WALL MATERIAL 2 (current)						WINDOW MATERIA	L
WALL MATERIAL (original) Wood						WINDOW TYPE	Double hung/casement/fix
WALL MATERIA	L 2 (original)					WINDOW CONFIG	1/1
		h overhanging eav storic 1/1 wood wi			ers; fu	Ill width front porch (alte	ered); three-part window

ALTERATIONS Porch columns/piers on porch appear to be replacement (not historic); porch screened in (not historic); replacement windows in dormer (enlarge openings, not historic); north exterior stair addition (not historic); one story rear addition

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
stre	dblock on west side of residential eet; front sidewalk; rear alley; nilar setbacks; mature trees
COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
PREPARER ORGANIZATION SURVEYDATE	GRANACKI HISTORIC CONSULTANTS 11/8/2007

135

WRIGHT

Ν



DIGITAL	\Images\wright13	DIGITAL	\Images\wright135n(3
PHOTO ID	5n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright13	DIGITAL	\Images\wright135n(4
PHOTO ID2	5n(2).jpg	PHOTOID4).jpg

STREET #	139				
DIRECTION	N				
STREET	WRIGHT				
SUFFIX	ST				
PIN	0818308010			NEW .	
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	C				
Contributing to a NR DISTRICT? Contributing second Listed on existing SURVEY?	C dary structure Local District;				
			GENERAL INFO	RMATION	
CATEGORY bu	ilding		CURRENT FUNCTIO	N Domestic - single dwel	ling
CONDITION ex	cellent		HISTORIC FUNCTIO	N Domestic - single dwel	ling
INTEGRITY minor alterations REASON for SIGNFICANCE Fine example of Craftsman Bungalow, with broad eaves and a front gable porch with stout columns on solid knee walls. SECONDARY STRUCTURE Detached garage Detached garage					
				DESCRIPTION	
ARCHITECTURA			ARCHITECTURAL	<u>DESCRIPTION</u> → PLAN	rectangular
CLASSIFICATION	Craftsmar	n Bungalow		NO OF STORIES	1.5
DETAILS				ROOF TYPE	Side gable
BEGINYEAR	c. 1925			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR				FOUNDATION	concrete
DATESOURCE	Surveyor			PORCH	Front
WALL MATERIA	L (current)	Brick		WINDOW MATERIA	
WALL MATERIA	L 2 (current)			WINDOW MATERIA	
WALL MATERIA	L (original)	Brick		WINDOW TYPE	Double hung/awning
WALL MATERIA	L 2 (original)			WINDOW CONFIG	91/ geometric; 9-light geo
		f with overhanging toric 9/1 and 9-ligh	eaves and exposed rafter ta t wood windows		
ALTERATIONS North side window filled with glass block (not historic); framing for door at porch entry (not historic); replacement porch steps and railing					

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	Midblock on west side of residential street; side driveway; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
139 N WRI	GHT

DIGITAL	\Image
PHOTO ID	9n.jpg
DIGITAL	\Image
PHOTO ID2	9n(2).

)	\Images\wright13 9n.jpg	DIGITAL PHOTO ID3
02	\Images\wright13 9n(2).jpg	DIGITAL PHOTOID4

\Images\wright139n(3).jpg
\Images\wright139n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	140			
DIRECTION	Ν	the are I	ATTA	
STREET	WRIGHT	i was I	ANA	
SUFFIX	ST		A A A A A	
PIN	0818309002		A.	1 dear 1
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	C			
Contributing to a NR DISTRICT?	С			
Contributing secon	dary structure? -		- Contraction	
Listed on existing SURVEY?	Local District; NR District			te de la company
		GENERAL INFO	RMATION	
CATEGORY bu	ilding	CURRENT FUNCTIO	N Education - school	
CONDITION ex	cellent	HISTORIC FUNCTIO	N Education - college	
INTEGRITY no	ot altered	REASON for SIGNFICANCE		
SECONDARY STRUCTURE				
	-	ARCHITECTURAL	DESCRIPTION	
ARCHITECTURA CLASSIFICATION		ary	PLAN	L
DETAILS			NO OF STORIES	3
BEGINYEAR	c. 1950		ROOF TYPE	Multi-gable
OTHER YEAR			ROOF MATERIAL	Ceramic Tile
-			FOUNDATION	Concrete
DATESOURCE	Surveyor			


DATESUURCE	Surveyor		PORCH -	
WALL MATERIA	L (current)	Brick		
WALL MATERIA	L 2 (current)		WINDOW MATERIAL	Metal
WALL MATERIA	I (original)	Brick	WINDOW MATERIAL	
		Dick	WINDOW TYPE	casement
WALL MATERIA	AL 2 (original)		WINDOW CONFIG	1-light
SIGNIFICANT FEATURES ALTERATIONS	L-shaped mass	sing; concrete panels at entry on gable	bay	

HISTORIC	
NAME	
COMMON NAME	Little Friends, Inc.
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
I EXMITS	
LANDSCAPE	Midblock on east side of residential
	street, parking lot to north; curving drive leading to another school
	building to south; mature trees

COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE

140 N WRIGHT

.

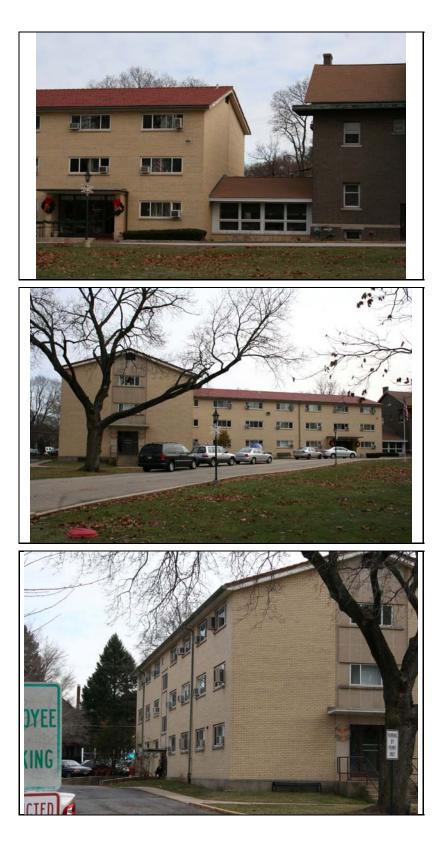

DIGITAL	\Images\wright14	DIGITAL	\Images\wright140n(3
PHOTO ID	0n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright14	DIGITAL	\Images\wright140n(4
PHOTO ID2	0n(2).jpg	PHOTOID4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	143			- All
DIRECTION	Ν			and the second s
STREET	WRIGHT			A A A
SUFFIX	ST			
PIN	0818308009			
LOCAL SIGNIFICANCE RATING	C		1	
POTENTIAL IND NR? (Y or N)	Ν			
			e c	
Contributing to a NR DISTRICT?	C			****
Contributing second	lary structure? C	A COLOR	The state of the state of	
Listed on existing SURVEY?	Local District; NR District			
GENERAL INFORMATION				
		GENERAL INFUR		
CATEGORY bu	ilding	CURRENT FUNCTION	Domestic - single dwel	ling
	ilding od			-
CONDITION go		CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel	-
CONDITION go INTEGRITY mi	od	CURRENT FUNCTION	Domestic - single dwel	-
CONDITION gc INTEGRITY mi SECONDARY	od	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel	-
CONDITION go INTEGRITY mi	od nor alterations and addition(s)	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel	-
CONDITION gc INTEGRITY mi SECONDARY	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel Domestic - single dwel Domestic - single dwel	ling
CONDITION go INTEGRITY mi SECONDARY STRUCTURE	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel DESCRIPTION PLAN	Rectangular
CONDITION go INTEGRITY mi SECONDARY STRUCTURE ARCHITECTURA	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel DESCRIPTION PLAN NO OF STORIES	Rectangular 2.5
CONDITION go INTEGRITY mi SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel DESCRIPTION PLAN NO OF STORIES ROOF TYPE	Rectangular 2.5 Hipped
CONDITION gc INTEGRITY mi SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Description PLAN NO OF STORIES ROOF TYPE ROOF MATERIAL	Rectangular 2.5 Hipped Asphalt - shingle
CONDITION gc INTEGRITY mi SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS BEGINYEAR	od nor alterations and addition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel DESCRIPTION PLAN NO OF STORIES ROOF TYPE	Rectangular 2.5 Hipped

WALL MATERIA	T (Brick	IORCII	Tom
WALL MATERIAL (current)		DIICK	WINDOW MATERIAL	Wood
WALL MATERIAL 2 (current)		vinyl		Weed
			WINDOW MATERIAL	
WALL MATERIAL (original)		Brick		
WALL MATERIAL 2 (original)		Wood	WINDOW TYPE	double hung/casement
		Wood	WINDOW CONFIG	4/1; 1-light
	Hipped roof wit classical surrou	h overhanging eaves and hipped dormer; historio	c 4/1 and 1-light wood win	dows; south side entry with

ALTERATIONS shed roof front porch addition (post-1943, but appears historic); vinyl siding on dormer walls and under eaves; two story rear addition

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential
	street; front sidewalk; side driveway; similar setbacks; mature trees
COA DATE	
COA DECISION	
DECISION	
PREPARER	Lara Ramsey
	GRANACKI HISTORIC
PREPARER PREPARER	GRANACKI HISTORIC CONSULTANTS
PREPARER PREPARER ORGANIZATI	GRANACKI HISTORIC CONSULTANTS E 11/12/2007

143 N WRIGHT



DIGITAL	\Images\wright14	DIGITAL	\Images\wright143n(3
PHOTO ID	3n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright14	DIGITAL	\Images\wright143n(4
PHOTO ID2	3n(2).jpg	PHOTOID4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	148		
DIRECTION	Ν	444	
STREET	WRIGHT	A CAR	
SUFFIX	ST		
PIN	0818309002		
LOCAL SIGNIFICANCE RATING	С		
POTENTIAL IND NR? (Y or N)	⁷ N	1	
Contributing to a NR DISTRICT?	C		
Contributing second	ndary structure? -	and the second sec	
Listed on existing SURVEY?	Local District; NR District	and the second second	
		GENERAL INFO	RMATION
CATEGORY	uilding	CURRENT FUNCTION	N Domestic - secondary structure
CONDITION g	ood	HISTORIC FUNCTION	N Domestic - secondary structure
INTEGRITY	ninor alterations and addition(s)	REASON for SIGNFICANCE	

SECONDARY STRUCTURE

ARCHITECTURAL DESCRIPTION

ARCHITECTURAL					r٩	ctangular
CLASSIFICATION	Garage			I LAN	10	etaligulai
				NO OF STORIES	2	
DETAILS				ROOF TYPE	Hi	pped
BEGINYEAR	c. 1910					FF
OTHER YEAR				ROOF MATERIAL	Ce	eramic Tile
UTHER TEAR				FOUNDATION	C	oncrete
DATESOURCE	Surveyor			DODGH		
WALL MATERIAL (c	urrent)	Brick		PORCH		
	,			WINDOW MATERIA	L	Wood
WALL MATERIAL 2	(current)			WINDOW MATERIA	T	
WALL MATERIAL (o	riginal)	Brick				
,	0 /			WINDOW TYPE		double hung/awning
WALL MATERIAL 2	(original)			WINDOW CONFIG		multi-light
				WINDOW CONFIG		mun-ngm
SIGNIELCANT Hipp	od roof wi	th coromic tilo	- historia multi light double hung	and awaing windows: two	h-214	aarago doors

SIGNIFICANT FEATURES	Hipped roof with ceramic tile; historic multi-light double hung and awning windows; two-bay garage doors
ALTERATIONS	Replacement garage doors; one story north addition (historic)windows in addition boarded up

HISTORIC NAME	Kroehler, P.E., Carriage House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
	/as originally carriage house for the . E. Kroehler House
PERMITS	
	Midblock on south side of residential street; parking lot to east; mature trees





COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
148 N WRI	ЭНТ

DIGITAL	\Images\wright14	DIGITAL
PHOTO ID	8n.jpg	PHOTO ID3
DIGITAL	\Images\wright14	DIGITAL
PHOTO ID2	8n(2).jpg	PHOTOID4

\Images\wright148n(3).jpg
\Images\wright148n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	151					
DIRECTION	Ν			ī.		
STREET	WRIGHT					
SUFFIX	ST			0		
PIN	0818141003			4		
LOCAL SIGNIFICANCE RATING	S					
POTENTIAL IND NR? (Y or N)) N					
Contributing to a NR DISTRICT?	С					
Contributing second	ndary structure	? C	and a strange	and Plant	A	The second second second
Listed on existing SURVEY?	Local District	NR District	1 1 2 A 2			
			GENERAL INFO	ORM	IATION	
CATEGORY b	ouilding		CURRENT FUNCTI	ON	Domestic - single dwelli	ng
CONDITION	jood		HISTORIC FUNCTI	ON	Domestic - single dwelli	ng
INTEGRITY	ninor alterations	3	REASON for SIGNFICANCE			v, with broad side gable roof a full-width front porch.
SECONDARY STRUCTURE	Detached ga	age				
			ARCHITECTURA	L D	ESCRIPTION	
ARCHITECTURA CLASSIFICATIO		n Bungalow			PLAN	rectangular
]	NO OF STORIES	1.5
DETAILS	0.1025				ROOF TYPE	Side gable
BEGINYEAR OTHER YEAR	c. 1925				ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor]	FOUNDATION	Not visible
WALL MATERIA		Brick			PORCH	Full front
WALL MATERIA		Wood			WINDOW MATERIA	L Wood
WALL MATERIA		Brick]	WINDOW MATERIA	
WALL MATERIA		Wood]	WINDOW TYPE	Double hung/casement/fix
	(B)				WINDOW CONFIG	3/1; 9-light; 7-light
SIGNIFICANT FEATURES		d 3-part window; ii				with stepped brackets and walls; historic wood double

ALTERATIONS Window in dormer removed for AC unit Addition to rear porch remodeling (HPC approved COA#10-1368)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	uthwest corner of School and
Wr	uthwest corner of School and ight; front and north sidewalks; ar alley; similar setbacks; mature
Wr	ight; front and north sidewalks; ar alley; similar setbacks; mature
Wi rea	ight; front and north sidewalks; ar alley; similar setbacks; mature
Wi rea	ight; front and north sidewalks; ar alley; similar setbacks; mature
Wi rea	ight; front and north sidewalks; ar alley; similar setbacks; mature
Wi rea	ight; front and north sidewalks; ar alley; similar setbacks; mature
COA DATE COA	ight; front and north sidewalks; ar alley; similar setbacks; mature
COA DATE	ight; front and north sidewalks; ar alley; similar setbacks; mature
COA DATE COA	ight; front and north sidewalks; ar alley; similar setbacks; mature es
COA DATE COA DECISION PREPARER	ight; front and north sidewalks; ar alley; similar setbacks; mature es
COA DATE COA DECISION	ight; front and north sidewalks; ar alley; similar setbacks; mature es
COA DATE COA DECISION PREPARER PREPARER	ight; front and north sidewalks; ar alley; similar setbacks; mature es
COA DATE COA DATE COA DECISION PREPARER PREPARER ORGANIZATION	ight; front and north sidewalks; ar alley; similar setbacks; mature es

-П ATTA AND dh. 5

DIGITAL	\Images\wright15	DIGITAL	\Images\wright151n(3
PHOTO ID	1n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright15	DIGITAL	\Images\wright151n(4
PHOTO ID2	1n(2).jpg	PHOTOID4).jpg

151 N WRIGHT

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

Asphalt - shingle

Not visible

Front entry

Wood

Double hung/casement/aw

6/1; 12-light; multi; 1/1

ROOF MATERIAL

WINDOW MATERIAL

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

FOUNDATION

PORCH

STREET #	204	
DIRECTION	Ν	
STREET	WRIGHT	
SUFFIX	ST	
PIN	0818143005	
LOCAL SIGNIFICANCE RATING	S	
POTENTIAL IND NR? (Y or N)	Ν	
Contributing to a NR DISTRICT?	C	
Contributing second	lary structure? C	
Listed on existing SURVEY?	Local District; NR District	
		GENERAL INFORMATION
CATEGORY bu	lding	CURRENT FUNCTION Domestic - single dwelling
CONDITION ex	cellent	HISTORIC FUNCTION Domestic - single dwelling
INTEGRITY Ad	dition(s)	REASON for Fine local example of Prairie Style with some Colonial details.
SECONDARY STRUCTURE	Detached garage Det. Gar. (NC)	
		ARCHITECTURAL DESCRIPTION
ARCHITECTURAI CLASSIFICATION		PLAN rectangular
DETAILS		NO OF STORIES 2.5
DETAILS	Colonial Revival	

SIGNIFICANT
FEATURES

OTHER YEAR

DATESOURCE

WALL MATERIAL (current)

WALL MATERIAL 2 (current)

WALL MATERIAL (original)

WALL MATERIAL 2 (original)

Surveyor

Brick

Brick

Wood - shingle

Wood - shingle

Hipped roof with overhanging eaves and front central hipped dormer; front entry porch with hipped roof and square brick columns; historic wood windows; south/rear sun porch

ALTERATIONS Two story rear addition Demolition of a chimney & in kind replacement (admin. approved COA#13-4149)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Northeast corner of Wright and School; front and south sidewalks; rear driveway; rear picket fence; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
204 N WRI	GHT

DIGITAL	∖Images∖
PHOTO ID	4n.jpg
DIGITAL	\Images\
PHOTO ID2	4n(2).jpg

)	\Images\wright20 4n.jpg	DIGITAL PHOTO ID3
02	\Images\wright20 4n(2).jpg	DIGITAL PHOTOID4

\Images\wright204n(3).jpg
\Images\wright204n(4).jpg

City of NAPERVILLE ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 205

STREET N. WRIGHT STREET

ADDITIONAL PHOTOS OR INFORMATION

Significant Features

Hipped roof with carved wood brackets (some with dropped pendants) under eaves; paneled wood frieze; 3-sided 2-story south window bay; front entry with double wood paneled doors, segmental arch transom, and incised wood surround; historic 2/2 and 1/1 wood windows with elaborate incised wood hoods and center wood keystones; south side entry with double wood door; porch with elaborate round arch wood openings

STREET #	205				
DIRECTION	Ν				
STREET	WRIGHT		South		
SUFFIX	ST			A A	
PIN	0818140010				- ANCASA
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	-	P C			
			GENERAL INFO	DRMATION	
CATEGORY bu	uilding		CURRENT FUNCTION	ON Domestic - single dwel	ling
CONDITION ex	cellent		HISTORIC FUNCTION	ON Domestic - single dwel	ling
INTEGRITY m SECONDARY STRUCTURE	inor alterations	and addition(s) age	SIGNFICANCE	Elegant Italianate residence window surrounds and corr and pendants. Listed on IH	nice with carved wood brackets
			ARCHITECTURA	LDESCRIPTION	
ARCHITECTURA CLASSIFICATION			<u>ARCHITECTORN</u>	PLAN	irregular
				NO OF STORIES	2
DETAILS BEGINYEAR	c. 1880			ROOF TYPE	Hipped
OTHER YEAR	C. 1000			ROOF MATERIAL	Asphalt - shingle
DATESOURCE		hure (East)		FOUNDATION	Concrete - block
WALL MATERIA		Wood		PORCH	Side
WALL MATERIA		11000		WINDOW MATERIA	AL Wood
WALL MATERIA		Wood		WINDOW MATERIA	
	-	11000		WINDOW TYPE	double hung
WALL MATERIA	L 2 (original)			WINDOW CONFIG	1/1; 2/2 vertical
FEATURES	story south win		try with double wood panel	pendants) under eaves; pa ed doors, segmental arch tr	neled wood frieze; 3-sided 2- ansom, and incised wood
				historic); 1/1 replacement v nent front stoop (not historic	vindow on east side of south c)

HISTORIC NAME	S	indlinger, George House
COMMON NAME		
COST		
ARCHITECT		
ARCHITECT	22	
BUILDER		
ARCHITECT SOURCE		
HISTORIC INFO	resid Evar 1908 1912	ording to NR nomination, this lence was purchased by the ngelical Theological Seminary in 8 and moved to its present site in 2 to serve as a dorm & married ents apts.
PERMITS		
LANDSCAPE	Sch rea ma	rtheast corner of Wright and hool, front and south sidewalks; r driveway; similar setbacks; ture trees; Alternate address is School Street
COA DATE	[
COA DECISION		
PREPARER	Ĺ	Lara Ramsey
PREPARER ORGANIZAT	TION	GRANACKI HISTORIC CONSULTANTS
SURVEYDAT	ГE	11/12/2007
SURVEYARI	EA	NAPERVILLE

205 N WRIGHT




DIGITAL	\Images\wright20	DIGITAL	\Images\wright205n(3
PHOTO ID	5n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright20	DIGITAL	\Images\wright205n(4
PHOTO ID2	5n(2).jpg	PHOTOID4).jpg

STREET #	210				+ /1
DIRECTION	Ν	1			No Di
STREET	WRIGHT		CARL CONTRACTOR		
SUFFIX	ST				
PIN	0818143004			-	
LOCAL SIGNIFICANCE RATING	С				
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	С				
Contributing second	dary structure?	С			
Listed on existing SURVEY?	Local District; N	NR District	and the second		·
			GENERAL INFO	RMATION	
CATEGORY bu	ilding		CURRENT FUNCTION	ON Domestic - single dwell	ing
CONDITION ex	cellent		HISTORIC FUNCTION	ON Domestic - single dwell	ing
INTEGRITY mi	nor alterations		REASON for SIGNFICANCE		
SECONDARY	Detached garage	ae			
STRUCTURE	_ chaoned gand,	30			
		<u>A</u>	RCHITECTURAI	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION				PLAN	rectangular
DETAILS				NO OF STORIES	1.5
BEGINYEAR	1923			ROOF TYPE	Side gable
OTHER YEAR	1920			ROOF MATERIAL	Asphalt - shingle
DATESOURCE	NCC			FOUNDATION	Concrete - block
WALL MATERIA		Wood		PORCH	Front
	· · L	wood		WINDOW MATERIA	L Wood
WALL MATERIA		Wood		WINDOW MATERIA	L Metal
WALL MATERIAL		wood		WINDOW TYPE	double hung/jalousie/casm
WALL MATERIA	L 2 (original)			WINDOW CONFIG	1/1; multi-light; 1-light
SIGNIFICANT FEATURES	Side gable roof v	with exposed rafter	tails; front gable porch w	vith battered piers	
			vs; replacement windows (admin. approved COA		

HISTORIC NAME	Kolthoff, Clyde P. & Ruth House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



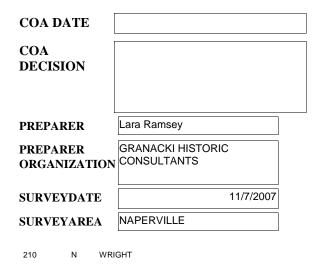

DIGITAL	\lma
PHOTO ID	0n.jp
DIGITAL	\lma
PHOTO ID2	0n(2

)	\Images\wright21 0n.jpg	DIGITAL PHOTO ID3
02	\Images\wright21 0n(2).jpg	DIGITAL PHOTOID4

\Images\wright210n(3).jpg
\Images\wright210n(4).jpg

STREET # DIRECTION STREET SUFFIX PIN LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	211 N WRIGHT ST 0818140009 NC N NC dary structure:				
			GENERAL INFO	RMATION	
CATEGORY bu	uilding		CURRENT FUNCTIO	N Domestic - multiple dwe	elling
CONDITION G	ood/Fair		HISTORIC FUNCTIO	N Domestic - single dwelli	ng
INTEGRITY m	ajor alterations	and/or addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	SECONDARY Detached garage STRUCTURE				
ARCHITECTURA			ARCHITECTURAL	<u> DESCRIPTION</u>	rectangular
CLASSIFICATION	N No Style				2.5
DETAILS				NO OF STORIES	
BEGINYEAR	c. 1900			ROOF TYPE	Front gable
OTHER YEAR				ROOF MATERIAL	Asphalt - shingle
DATESOURCE	surveyor			FOUNDATION	Parged/concrete
WALL MATERIA	L (current)	Vinyl		PORCH	Front entry
WALL MATERIA	L 2 (current)			WINDOW MATERIA	,
WALL MATERIA	L (original)	Wood		WINDOW MATERIA	
WALL MATERIA	-			WINDOW TYPE	double hung
SIGNIFICANT FEATURES ALTERATIONS	Original house		ry front addition (my have o ndows in original opening or		1/1 addition that was enclosed);
	viriyi siairig; rep	nacement vinyi wir	loows in original opening of	in side elevations	

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/12/2007
SURVEYAREA	NAPERVILLE
211 N WRI	ЭНТ

DIGITAL	\
PHOTO ID	1
DIGITAL	\I
PHOTO ID2	1

D	\Images\wright21 1n.jpg	DIGITAL PHOTO ID3
D2	\Images\wright21 1n(2).jpg	DIGITAL PHOTOID4

\Images\wright211n(3).jpg
\Images\wright211n(4).jpg

STREET #	215				
DIRECTION	Ν				
STREET	WRIGHT				A NO TO TO
SUFFIX	ST				States And
PIN	0818143008		AT THE REAL PROPERTY AND A PROPERTY		
LOCAL SIGNIFICANCE RATING	С				
POTENTIAL IND NR? (Y or N)	N				
Contributing to a NR DISTRICT?	C	? C			
Contributing secon Listed on existing SURVEY?	Local District				
			GENERAL INFO	RMATION	
CATEGORY b	ouilding		CURRENT FUNCTIO	N Domestic - multiple dw	relling
CONDITION	jood		HISTORIC FUNCTIO	N Domestic - single dwel	ling
INTEGRITY	ninor alterations	and addition(s)	REASON for		
			SIGNFICANCE		
SECONDARY Detached garage					
				DECONDITION	
ARCHITECTUR			ARCHITECTURAL	\rightarrow PLAN	rectangular
CLASSIFICATIO	N Queen Ar	nne		NO OF STORIES	2.5
DETAILS				ROOF TYPE	Side gable
BEGINYEAR	c. 1905			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR				FOUNDATION	Concrete - block
DATESOURCE	Surveyor			PORCH	Full front
WALL MATERIA	AL (current)	Wood		WINDOW MATERIA	
WALL MATERIA	AL 2 (current)	Wood - shingle		WINDOW MATERIA	
WALL MATERIA	AL (original)	Wood		WINDOW TYPE	Double hung/single hung
WALL MATERIA	AL 2 (original)	Wood - shingle		WINDOW CONFIG	1/1
SIGNIFICANT FEATURES	Side gable roo historic 1/1 woo		able; cornice returns; front p		
ALTERATIONS			not historic); rear porch addi ersion); replacement porch fl		under gable (not historic); 2 historic)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/12/2007
SURVEYAREA	NAPERVILLE
215 N WRI	ЭНТ

DIGITAL	\ln
PHOTO ID	5n
DIGITAL	\ln
PHOTO ID2	5n

D	\Images\wright21 5n.jpg	DIGITAL PHOTO ID3
D2	\Images\wright21 5n(2).jpg	DIGITAL PHOTOID4

\Images\wright215n(3).jpg
\Images\wright215n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	216			
DIRECTION	Ν			
STREET	WRIGHT			
SUFFIX	ST		AND THE REAL PROPERTY	
PIN	0818140003			
LOCAL SIGNIFICANCE RATING	S			
POTENTIAL IND NR? (Y or N)	Ν			
Contributing to a NR DISTRICT? Contributing second Listed on existing				
SURVEY?	Local District; NR District			
SURVEY?	Local District; NR District	GENERAL INFOR	RMATION	
	ILOCAI District; NR District	GENERAL INFOR		ling
CATEGORY bu			N Domestic - single dwel	•
CATEGORY bu CONDITION ex	ilding	CURRENT FUNCTION HISTORIC FUNCTION REASON for Th	N Domestic - single dwel	ing Foursquare with distinctive
CATEGORY bu CONDITION ex	ilding	CURRENT FUNCTION HISTORIC FUNCTION REASON for Th	N Domestic - single dwel N Domestic - single dwel	ing Foursquare with distinctive
CATEGORY bu CONDITION ex INTEGRITY ac SECONDARY STRUCTURE	ilding cellent ldition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for Th	Domestic - single dwel Domestic - single dwel nis handsome American F ont porch is almost comple	ing Foursquare with distinctive
CATEGORY bu CONDITION ex INTEGRITY ac SECONDARY	ilding cellent ldition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for Tr SIGNFICANCE	Domestic - single dwel Domestic - single dwel nis handsome American F ont porch is almost comple	ing Foursquare with distinctive
CATEGORY bu CONDITION ex INTEGRITY ac SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION	ilding cellent ldition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for Tr SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel his handsome American F ont porch is almost comple DESCRIPTION	ing Foursquare with distinctive etely unaltered.
CATEGORY bu CONDITION ex INTEGRITY ac SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	ilding cellent ldition(s) Detached garage L American Foursquare Colonial Revival	CURRENT FUNCTION HISTORIC FUNCTION REASON for Tr SIGNFICANCE	Domestic - single dwell Domestic - single dwell bis handsome American F ont porch is almost comple DESCRIPTION PLAN	ling Foursquare with distinctive etely unaltered.
CATEGORY bu CONDITION ex INTEGRITY ac SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION	ilding cellent ldition(s) Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for Tr SIGNFICANCE	Domestic - single dwell Domestic - single dwell bis handsome American F ont porch is almost comple DESCRIPTION PLAN NO OF STORIES	ing Foursquare with distinctive etely unaltered. rectangular 2.5

WALL MATERL	AL (current)	Brick		
			WINDOW MATERIAL	Wood
WALL MATERL	AL 2 (current)		WINDOW MATERIAL	Leaded glass
WALL MATERL	AL (original)	Brick		
			WINDOW TYPE	Double hung/casement/aw
WALL MATERI	AL 2 (original)			
			WINDOW CONFIG	3/1; diamond; 3-light
SIGNIFICANT FEATURES		ith overhanging eaves and front hipped dormer ick piers and brick knee walls; 3-part window un windows		
	0			

PORCH

Full front

ALTERATIONS One story rear addition

Surveyor

Brick

DATESOURCE

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
216 N WRI	GHT

DIGITAL	\Images\wright21	DIGITAL
PHOTO ID	6n.jpg	PHOTO ID3
DIGITAL	\Images\wright21	DIGITAL
PHOTO ID2	6n(2).jpg	PHOTOID4

\Images\wright216n().jpg	3
\Images\wright216n().jpg	4


ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	219	1	NAME TO DE L
DIRECTION	N		
STREET	WRIGHT		
SUFFIX	ST	William Contraction	
PIN	0818140007	Ville V	
LOCAL SIGNIFICANCE			
RATING	S		
POTENTIAL IND NR? (Y or N)	N		
		I BOL	
Contributing to a NR DISTRICT?	С		
Contributing second	dary structure? C		
Listed on existing SURVEY?	Local District; NR District		
		GENERAL INFO	DRMATION
CATEGORY bu	ilding	CURRENT FUNCTION	ON Domestic - single dwelling
CONDITION go	od	HISTORIC FUNCTI	ON Domestic - single dwelling
INTEGRITY mi	nor alterations		Fine, intact example of the American Foursquare type, with Queen Anne - Free Classic details.
SECONDARY STRUCTURE	Barn	_	

ARCHITECTURAL DESCRIPTION

ARCHITECTURA	-	_		- PLAN	rea	ctangular
CLASSIFICATIO	N American	Foursquare				
DETAILS	Queen An	ne - Free Cla		NO OF STORIES	2.5	5
DETAILS			3510	ROOF TYPE	Ga	able on hip
BEGINYEAR	1909			ROOF MATERIAL	Δ.c	phalt chingle
OTHER YEAR				KOUF MATERIAL	AS	phalt - shingle
				FOUNDATION	Сс	oncrete - block
DATESOURCE	Owner			PORCH	Fu	III front
WALL MATERIA	L (current)	Wood				
WALL MATERIA	L 2 (current)			WINDOW MATERIA	L	Wood
				WINDOW MATERIA	L	
WALL MATERIA	L (original)	Wood		WINDOW TYPE		
WALL MATERIA	L 2 (original)					Double hung/awning
				WINDOW CONFIG		1/1; multi-light
			de gables; hipped roof front porch 1/1 double hung and multi-light a			
ALTERATIONS	Replacement ra	ailings on por	ch (not historic); rear deck additior	n (not historic)		

HISTORIC NAME	Keller, George K. House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	Midblock on west side of residential street; front sidewalk; rear alley; rear picket fence; similar setbacks; mature trees

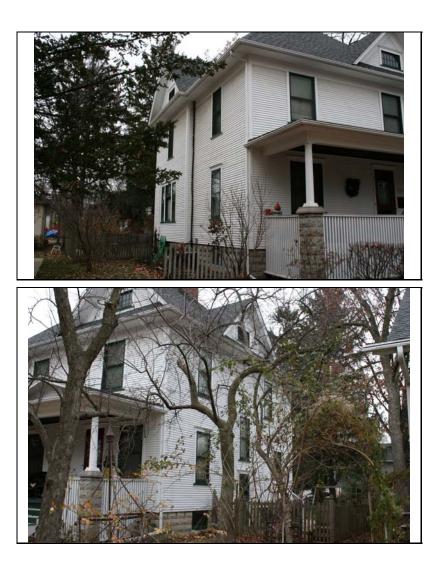

COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/12/2007
SURVEYAREA	NAPERVILLE
219 N WRI	GHT

DIGITAL	\lma
PHOTO ID	9n.jj
DIGITAL	\lma
PHOTO ID2	9n(2

)	\Images\wright21 9n.jpg	DIGITAL PHOTO ID3
02	\Images\wright21 9n(2).jpg	DIGITAL PHOTOID4

\Images\wright219n(3).jpg
\Images\wright219n(4).jpg

STREET #	225				
DIRECTION	Ν		3 Y		The second secon
STREET	WRIGHT		ALL NO BIT	K	
SUFFIX	ST				interested
PIN	0818140006	<u>.</u>			A A A
LOCAL SIGNIFICANCE RATING	С				
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	NR DISTRICT?				
-	dary structure	? NC			
Listed on existing SURVEY?	Local District; NR District				
GENERAL INFORMATION					
CATEGORY bu	uilding		CURRENT FUNCTIO	Domestic - single dwe	lling
CONDITION go	bod		HISTORIC FUNCTION	Domestic - single dwe	lling
INTEGRITY	inor alterations	3	REASON for SIGNFICANCE		
SECONDARY	Deteched				
STRUCTURE	Detached ga	rage			
			ARCHITECTURAI	DESCRIPTION	
ARCHITECTURA CLASSIFICATION				PLAN	rectangular
	Bullgalov	V		NO OF STORIES	1.5
DETAILS				ROOF TYPE	Side gable
BEGINYEAR	c. 1920			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR				FOUNDATION	Concrete - block
DATESOURCE	Surveyor			PORCH	Full front
WALL MATERIA		Aluminum		WINDOW MATERL	AL Wood
WALL MATERIAL 2 (current)		WINDOW MATERIAL Vinyl		AL Vinvl	
				WINDOW MATERI	
WALL MATERIA		Wood			
WALL MATERIA WALL MATERIA	L (original)	Wood		WINDOW TYPE	double hung
WALL MATERIA	L (original) L 2 (original) Side gable roo	f with front facing	gable dormer; integrated op all; historic 3/1 and 4/1 wood	WINDOW TYPE WINDOW CONFIG en front porch with south e	double hung 3/1; 4/1; 1/1

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Southwest corner of North and Wright; front and north sidewalks; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/12/2007
SURVEYAREA	NAPERVILLE
225 N WRI	GHT


DIGITAL	∖lma(
PHOTO ID	5n.jp
DIGITAL	\lmag
PHOTO ID2	5n(2)

)	\Images\wright22 5n.jpg	DIGITAL PHOTO ID3
02	\Images\wright22 5n(2).jpg	DIGITAL PHOTOID4

\Images\wright225n(3).jpg
\Images\wright225n(4).jpg

STREET #	127				
DIRECTION	S			HAC	4.4
STREET	WRIGHT	- A Far		ALC:	74
SUFFIX	ST		SAN MARK		Nel mar
PIN	0818322014				
LOCAL SIGNIFICANCE RATING	S				
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	С				
Contributing secon	ndary structure	? NC			
Listed on existing SURVEY?	IHSS (O); Lo	cal District; NR			
GENERAL INFORMATION					
CATEGORY b	uilding		CURRENT FUNCTION	DN Domestic - single dwell	ing
CONDITION g	ood		HISTORIC FUNCTION	ON Domestic - single dwell	ing
INTEGRITY	ddition(s)				man Bungalow includes fine
SECONDARY Detached garage STRUCTURE Detached garage					
			ARCHITECTURAI	L DESCRIPTION	
ARCHITECTURA CLASSIFICATIO		n Bungalow		PLAN	L
		T Burigalow		NO OF STORIES	1
DETAILS	c. 1920			ROOF TYPE	Hipped
BEGINYEAR	C. 1920			ROOF MATERIAL	Asphalt shingle
OTHER YEAR DATESOURCE	Surveyor			FOUNDATION	Concrete - poured
WALL MATERIA		Stucco		PORCH	Full front
WALL MATERIA		Wood - shingle		WINDOW MATERIA	L Wood/Leaded glass
WALL MATERIA		Stucco		WINDOW MATERIA	L Vinyl
WALL MATERIA				WINDOW TYPE	Casement/fixed
	()B)	L		WINDOW CONFIG	1-light; multi-light
			ils; leaded glass windows; window bay; square projec	inset front porch structure ting north window bay	with stucco square piers on
ALTERATIONS	1-story south/re	ear addition			

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE Midblock on west side of restreet; front sidewalk; rear similar setbacks; mature tr	alley;

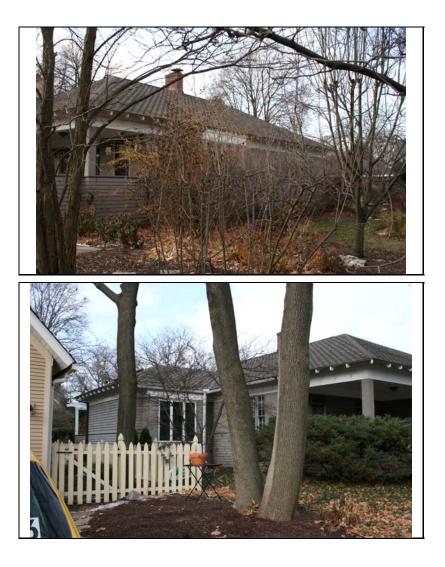

COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
127 S WRI	GHT

DIGITAL	∖lma
PHOTO ID	7s.jj
DIGITAL	\lma
PHOTO ID2	7s(2

)	\Images\wright12 7s.jpg	DIGITAL PHOTO ID3
02	\Images\wright12 7s(2).jpg	DIGITAL PHOTOID4

\Images\wright127s(3).jpg
\Images\wright127s(4).jpg

STREET #	122							
DIRECTION	S				1			
STREET	WRIGHT							
SUFFIX	ST							
PIN	0818323003							
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	C							
Contributing to a NR DISTRICT?	C							
Contributing secon	ndary structure	? C		and	- A Contraction	and an		
Listed on existing SURVEY?	Local District	; NR District						
	GENERAL INFORMATION							
CATEGORY b	uilding		CURRENT FUNCTIO	DN Domestic	- single dwell	ling		
				ON Domestic	Domestic - single dwelling			
INTEGRITY	ninor alterations	s and addition(s)	REASON for SIGNFICANCE					
SECONDARY STRUCTURE	Detached gar	rage						
			ARCHITECTURAL	DESCRI	PTION			
ARCHITECTURA CLASSIFICATIO				PLAN		rectangular		
	Durigalow	, 			STORIES	1.5		
DETAILS				ROOF	TYPE	Hipped		
BEGINYEAR	c. 1910			ROOF N	ATERIAL	Asphalt - shingle		
OTHER YEAR				FOUND	ATION	Stone		
DATESOURCE	Surveyor			PORCH	Ι	Front		
WALL MATERIA		Wood		WINDO	W MATERIA	L Wood		
WALL MATERIA		Wood - shingle		WINDO	W MATERIA	۰L		
WALL MATERIAL (original) Wood			WINDO	WINDOW TYPE double hung/casement				
WALL MATERIAL 2 (original)				WINDO	W CONFIG	1/1; 1-light		
SIGNIFICANT FEATURES Hipped roof with front gable north bay; inset front porch (altered); historic 1/1 and 1-light wood windows								
ALTERATIONS	concroto block	niara an frant nara	h (may ba historia altoratia	n), chod roof	auth darmar	addition; front hipped dormer		

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; south side lot; rear/side wood fence; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
122 S WRI	GHT

DIGITAL	\lma
PHOTO ID	2s.j
DIGITAL	\lma
PHOTO ID2	2s(2

)	\Images\wright12 2s.jpg	DIGITAL PHOTO ID3
2	\Images\wright12 2s(2).jpg	DIGITAL PHOTOID4

\Images\wright122s(3).jpg
\Images\wright122s(4).jpg

STREET #	6				
DIRECTION	Ν				
STREET	WRIGHT				
SUFFIX	ST				
PIN	0818312004				
CONDITION ex	Local District; iilding	NR District			<u> </u>
INTEGRITY	inor alterations	and addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached gar	age			
	T		ARCHITECTURAL	DESCRIPTION	
ARCHITECTURA CLASSIFICATION		ine		PLAN	rectangular
DETAILS				NO OF STORIES	2
BEGINYEAR	c. 1900			ROOF TYPE	Hipped
OTHER YEAR				ROOF MATERIAL	Asphalt - shingle
DATESOURCE	surveyor			FOUNDATION	Concrete - block
WALL MATERIA		Wood		PORCH	-
WALL MATERIA		Wood - shingle		WINDOW MATERIA	AL Wood
WALL MATERIA	L (original)	Wood		WINDOW MATERIA	
WALL MATERIAL 2 (original) Wood - shingle			WINDOW TYPE	double hung	
-				WINDOW CONFIG	1/1
FEATURES	1/1 wood windo	ows; 1st story south	side window bay		ory gabled south bay; historic
N	window on sou	th first story (histori	enclosed with 3/1 windows c); replacement siding (app and creation of a new 2 sto	propriate)	uth addition; replacement 3/1

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Northeast corner of Wright and Benton; front and south sidewalks; rear alley; rear and south picket fence; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
6 N WRI	GHT

DIGITAL	\lmages\wi
PHOTO ID	6n.jpg
DIGITAL	\Images\wi
PHOTO ID2	6n(2).jpg

	\Images\wright00 6n.jpg	DIGITAL PHOTO ID3			
2	\Images\wright00 6n(2).jpg	DIGITAL PHOTOID4			

\Images\wright006n(3).jpg
\Images\wright006(4). jpg

STREET #	6		X	KI C. K. M.	24	4.6 M 1 1 1 1 1		
DIRECTION	S		2	4/1	T I			
STREET	WRIGHT			Alt				
SUFFIX	ST			S SAN	1 r			
PIN	0818318001						1	
LOCAL			1	ENAME:				
SIGNIFICANCE RATING	S			- Colora - Colora	1		7	and the second second
POTENTIAL IND) N				አተ			
NR? (Y or N)	IN							
Contributing to a								
NR DISTRICT?	С				Non-Sec.		No. Pr	and the second second
Contributing second	ndary structure	? NC						
Listed on existing SURVEY?	IHSS (O): Lo	cal District; NR						
SURVEI	1100 (0), 200						1	
_				ENERAL INFO	r			
CATEGORY b	ouilding			CURRENT FUNCTI	L	Domestic - single dwelli	-	
CONDITION	lood		H	HISTORIC FUNCTI	ON	Domestic - single dwelling		
INTEGRITY	iddition(s)			REASON for SIGNFICANCE	Hano porc	dsome Colonial Revival h.	with	n nicely detailed front
SECONDARY			~		P 01 0			
STRUCTURE	Detached gar	age						
			AR	CHITECTURA	L D	ESCRIPTION		
ARCHITECTURA CLASSIFICATIO		Povival				PLAN	rec	tangular
						NO OF STORIES	2.5	
DETAILS	Prairie					ROOF TYPE	Hip	ped
BEGINYEAR	c. 1925					ROOF MATERIAL	As	ohalt - shingle
OTHER YEAR						FOUNDATION	cor	ncrete
DATESOURCE	surveyor	Deiste				PORCH	Frc	ont entry
WALL MATERIA		Brick]	WINDOW MATERIA	L	wood
WALL MATERIA		wood]	WINDOW MATERIAL		
WALL MATERIAL (original) Brick WALL MATERIAL 2 (original) Wood				WINDOW TYPE	[single & double hung/case		
WALL MATERIA	AL 2 (original)	Wood				WINDOW CONFIG		1/1; 1-light
SIGNIFICANT FEATURES		sed brick entry b				ners; hipped front entry ghts; 3-sided square nor		ch w/ grouped classical /indow bay; historic wood
ALTERATIONS	Second story re	ear porch additic	on (post-	1943)				

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Southeast corner of Wright and Benton; front and north sidewalks; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
6 S WRIC	GHT

DIGITAL	\Images\wrig		
PHOTO ID	6s.jpg		
DIGITAL	\Images\wrig		
PHOTO ID2	6s(2).jpg		

	\Images\wright00 6s.jpg	DIGITAL PHOTO ID3			
2	\Images\wright00 6s(2).jpg	DIGITAL PHOTOID4			

\Images\wright006s(3).jpg
\Images\wright006s(4).jpg

STREET #	7					1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	14	
DIRECTION	Ν		ý.				N.	A TAV
STREET	WRIGHT							
SUFFIX	ST							
PIN	0818311008							
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon	C N C dary structure?	P NC						
Listed on existing SURVEY?	_	cal District; NR		an a				ALL STREET
			(GENERAL INFO)RN	MATION		
CATEGORY bu	uilding			CURRENT FUNCTION	ON	Domestic - single dwell	ing	
CONDITION excellent HISTORIC FUNCTION Domestic - single dwelling								
INTEGRITY M	inor alterations			REASON for SIGNFICANCE				
SECONDARY STRUCTURE	Detached gar Greenhouse (-		SIGNFICANCE				
			AR	CHITECTURA	L D	ESCRIPTION		
ARCHITECTURA CLASSIFICATION						PLAN	rec	ctangular
DETAILS	Colonial F	Pevival				NO OF STORIES	2	
BEGINYEAR	c. 1870					ROOF TYPE	Hip	oped
OTHER YEAR	0. 1070					ROOF MATERIAL	As	phalt - shingle
DATESOURCE	Surveyor					FOUNDATION	Sto	one
WALL MATERIA		Wood				PORCH		ont entry
WALL MATERIA						WINDOW MATERIA	L	Wood
WALL MATERIA	L (original)	Wood				WINDOW MATERIA	L	
WALL MATERIA	L 2 (original)					WINDOW TYPE		double hung
						WINDOW CONFIG		2/2; 4/4; 6/6
				dillions; pedimented fr bay; classical corner p		entry porch with classica ters	ıl co	lumns; historic double
(historic), and f		ded; 2r	nd story north addition		eplacement front entry po t historic)	orcł	n (historic), wood siding

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Northwest corner of Wright and Benton; front sidewalk; rear alley; similar setbacks; mature trees





COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
7 N WRI	GHT

DIGITAL	\Images\wright00	DIGITAL
PHOTO ID	7n.jpg	PHOTO ID3
DIGITAL	\Images\wright00	DIGITAL
PHOTO ID2	7n(2).jpg	PHOTOID4

\Images\wright007n(3).jpg
\Images\wright007(4). jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	9	
DIRECTION	S	
STREET	WRIGHT	
SUFFIX	ST	
PIN	0818317009	
LOCAL SIGNIFICANCE RATING	S	
POTENTIAL IND NR? (Y or N)	N	
Contributing to a NR DISTRICT?	С	
Contributing second	dary structure? C	
Listed on existing SURVEY?	Local District; NR District	
		GENERAL INFORMATION

CATEGORY	building	CURRENT FUNCTION	ON Domestic - single dwelling
CONDITION	good	HISTORIC FUNCTION	ON Domestic - single dwelling
INTEGRITY	minor alterations		Fine, well-preserved example of early 20th-century Queen Anne.
SECONDARY STRUCTURE	Detached garage		

ARCHITECTURAL DESCRIPTION

ARCHITECTURA				¬ PLAN	irre	egular
CLASSIFICATIO	N Queen A	nne - Free Clas	sic	LAN	inc	,90101
				NO OF STORIES	2	
DETAILS				ROOF TYPE	Fro	ont gable
BEGINYEAR	c. 1900					
OTHER YEAR				ROOF MATERIAL	As	phalt - shingle
-				FOUNDATION	Sto	one
DATESOURCE	surveyor			PORCH	Fro	ont
WALL MATERIA	L (current)	Wood				
				WINDOW MATERIA	L	Wood
WALL MATERIA	L 2 (current)			WINDOW MATERIA	r	
WALL MATERIA	L (original)	Wood			L	
		mood		WINDOW TYPE	ļ	Double hung/single hung
WALL MATERIA	L 2 (original)					
				→ WINDOW CONFIG		1/1
SIGNIFICANT	Front gable ba	v with full heigh	t south bay with cutaway corners;	full front porch with class	sica	l columns and square
FEATURES		wood windows	t bouth buy with butaway comore,		100	
ALTERATIONS	Fixed shutters	(not historic); p	ossible 2nd story rear addition; re	placement front steps an	d ra	ailings (not historic)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
\$	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
9 S WRIG	GHT

\lma 9s.jp
\lma 9s(2

)	\Images\wright00 9s.jpg	DIGITAL PHOTO ID3
02	\Images\wright00 9s(2).jpg	DIGITAL PHOTOID4

\Images\wright009s(3).jpg
\Images\wright009s(4).jpg

STREET #	10		1		A.L.		ŧ	
DIRECTION	S		N)	TI-X			-	it.
STREET	WRIGHT				and a	11 II		and the second second
SUFFIX	ST			and a				1 State
PIN	0818318002							
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	C N C dary structure: Local District;							
_				ENERAL INFO	_			
	uilding			CURRENT FUNCTION		Domestic - multiple dwe		
CONDITION go	bod			HISTORIC FUNCTIO	ON [Domestic - multiple dwe	ellin	g
INTEGRITY m	inor alterations	3		REASON for SIGNFICANCE				
SECONDARY STRUCTURE	Detached gar	age						
			AR	CHITECTURAI	L DF	ESCRIPTION		
ARCHITECTURA CLASSIFICATION						PLAN	rec	tangular
						NO OF STORIES	2	
DETAILS	a 1055					ROOF TYPE	Hip	pped
BEGINYEAR	c. 1955					ROOF MATERIAL	As	phalt - shingle
OTHER YEAR	curvovor					FOUNDATION	No	t visible
DATESOURCE	surveyor	Brick				PORCH	-	
WALL MATERIA		DIICK				WINDOW MATERIA	L	Wood
WALL MATERIA		Brick				WINDOW MATERIA	L	
WALL MATERIA	-	DIICK				WINDOW TYPE		Double hung/fixed
WALL MATERIA	L 2 (original)					WINDOW CONFIG		2/1; 1-light
SIGNIFICANT FEATURES	Hipped roof wit	h overhanging ea	aves; h	ipped canopy over en	ntry ai	nd first story windows		
ALTERATIONS	Aluminum sidin	ng under eaves						

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
10 S WRI	CHT

DIGITAL	\Image
PHOTO ID	0s.jpg
DIGITAL	\lmage
PHOTO ID2	0s(2).j

)	\Images\wright01 0s.jpg	DIGITAL PHOTO ID3
02	\Images\wright01 0s(2).jpg	DIGITAL PHOTOID4

\Images\wright010s(3).jpg
\Images\wright010s(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	13							4/2/7
DIRECTION	N					r	A LAN	the states
STREET	WRIGHT		14			A2		
SUFFIX	ST		27.		1.00	Y		1X - AK
PIN	0818311007		- Ar		10×		The second se	
LOCAL SIGNIFICANCE RATING	С				· Martin			
POTENTIAL IND NR? (Y or N)	Ν				Ŷ			
Contributing to a NR DISTRICT?	C	•						
Contributing secon	dary structure	? -	11 (A)			Jej		2
Listed on existing SURVEY?	Local District	; NR District			all a sub-	Service .	and the second second	
			<u> </u>	GENERA	AL INFO	ORM	IATION	
CATEGORY bu	uilding				Γ FUNCTIO	F	Domestic - single dwell	ina
						L		
CONDITION excellent HISTORIC FUNCTION Dome					Domestic - single dwell	ing		
INTEGRITY	ajor alterations	s and/or addition	on(s)	REASON				
SECONDARY STRUCTURE								
			Al	RCHITE	CTURAI	L DI	ESCRIPTION	
ARCHITECTURA CLASSIFICATION							PLAN	L
DETAILS							NO OF STORIES	2
BEGINYEAR	c. 1880						ROOF TYPE	Multi-gable
OTHER YEAR	0. 1000						ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor						FOUNDATION	Stone/concrete block
WALL MATERIA		Wood					PORCH	-
WALL MATERIA							WINDOW MATERIA	L Wood
WALL MATERIA		Wood					WINDOW MATERIA	L
WALL MATERIA							WINDOW TYPE	double hung/casement
	z z (vi igiliai)						WINDOW CONFIG	6/9; 8/12; 1/1; 8-light
	Appears to hav windows (prob			ed ell, with f	ront gable a	and s	outh side gabled ellh	istoric 6/9 and 8/12 wood

ALTERATIONS South extension of roofline on front gable bay with new south side entry and stoop (post-1943); 2 story north side addition (historic); 1 story rear addition

Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees; rear bicket fence



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
13 N WRI	GHT

DIGITAL	\Images\wrig
PHOTO ID	3n.jpg
DIGITAL	\Images\wrig
PHOTO ID2	3n(2).jpg

	\Images\wright01 3n.jpg	DIGITAL PHOTO ID3
2	\Images\wright01 3n(2).jpg	DIGITAL PHOTOID4

\Images\wright013n(3).jpg
\Images\wright013n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	15			31 2 7			
DIRECTION	S		(ad)				NTA PE
STREET	WRIGHT		200	S. March			WHERE &
SUFFIX	ST		1. 20				
PIN	0818317010		0.02	In the second second			
LOCAL SIGNIFICANCE RATING	PS						
POTENTIAL IND NR? (Y or N)	Ν				E .		-
Contributing to a NR DISTRICT?	С						
Contributing secon	dary structure	? C					
Listed on existing SURVEY?	Local District	; NR District	and a				
				GENERAL INFO	ORN	IATION	
CATEGORY bu	ilding			CURRENT FUNCTI	ON	Domestic - single dwelli	ng
CONDITION good			HISTORIC FUNCTION Domestic - single dwelling				
INTEGRITY	inor alterations	s and additior	n(s)	REASON for SIGNFICANCE		d example of the Americ alterations.	an Foursquare type, with very
SECONDARY STRUCTURE	Detached ga	rage					
			Al	RCHITECTURA	LD	ESCRIPTION	
ARCHITECTURA CLASSIFICATION		Foursquare				PLAN	rectangular
DETAILS		•				NO OF STORIES	2.5
BEGINYEAR	c. 1915					ROOF TYPE	Hipped
OTHER YEAR	0. 1010					ROOF MATERIAL	Asphalt - shingle
DATESOURCE Surveyor					FOUNDATION	Parged	
WALL MATERIAL (current) Wood					PORCH	Full front	
WALL MATERIA						WINDOW MATERIA	wood
WALL MATERIA		Wood				WINDOW MATERIA	
WALL MATERIA	-					WINDOW TYPE	Double hung/single hung
	- (B)					WINDOW CONFIG	1/1
SIGNIFICANT	Hipped roof wi	th overhangir	ig eaves;	front dormer; hipped f	ront (oorch with classical colu	nns on solid knee wall;

FEATURES

ALTERATIONS Door replaced; fixed shutters

historic 1/1 wood windows

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
15 S WRI	GHT

DIGITAL	\Images
PHOTO ID	5s.jpg
DIGITAL	\Images
PHOTO ID2	5s(2).jp

I	\Images\wright01 5s.jpg	DIGITAL PHOTO ID3
2	\Images\wright01 5s(2).jpg	DIGITAL PHOTOID4

\Images\wright015s(3).jpg
\Images\wright015s(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

Wood

double & single hung/fixed

3/1; 5/1; 1-light

STREET #	16	A FRANKING A		1
DIRECTION	Ν	CAC MARK		$\langle \cdot \rangle$
STREET	WRIGHT			Jan III
SUFFIX	ST		and the second s	
PIN	0818312003		1 AVAN	
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	C			
Contributing to a NR DISTRICT? Contributing second Listed on existing SURVEY?	C			
		GENERAL INFORM	MATION	
CATEGORY bu	ilding	GENERAL INFORM	MATION Domestic - single dwel	ling
	ilding cellent			
CONDITION ex		CURRENT FUNCTION	Domestic - single dwel	
CONDITION ex	cellent	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel	
CONDITION ex INTEGRITY ma SECONDARY STRUCTURE	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel	
CONDITION ex INTEGRITY ma SECONDARY	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE ARCHITECTURAL D	Domestic - single dwel	
CONDITION EX INTEGRITY ma SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE ARCHITECTURAL D	Domestic - single dwel Domestic - single dwel ESCRIPTION	
CONDITION EX INTEGRITY ma SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE ARCHITECTURAL D	Domestic - single dwel Domestic - single dwel ESCRIPTION PLAN	irregular
CONDITION EX INTEGRITY ma SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS BEGINYEAR	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE ARCHITECTURAL D	Domestic - single dwel Domestic - single dwel PESCRIPTION PLAN NO OF STORIES	ling ling irregular Two
CONDITION EX INTEGRITY ma SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	cellent ajor alterations and/or addition(s Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE ARCHITECTURAL D	Domestic - single dwel Domestic - single dwel PESCRIPTION PLAN NO OF STORIES ROOF TYPE	irregular Two Front gable

			PORCH	IV'
WALL MATERIA	AL (current)	Wood	WINDOW MATERIAI	L
WALL MATERIA	AL 2 (current)		WINDOW MATERIAI	
WALL MATERIA	AL (original)	Wood		L
WALL MATERIA	AL 2 (original)		WINDOW TYPE	
			WINDOW CONFIG	
SIGNIFICANT	Front gable roc	f with cornice returns		
FEATURES				

Replacement siding & verge board (not historic); wraparound front porch w/ 1 story entry add. on S. side (not ALTERATIONS historic); large 2-story rear (south) addition (not historic); replacement windows in original openings on original house (may be historic)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
16 N WRI	GHT

DIGITAL	\Images\
PHOTO ID	6n.jpg
DIGITAL	\lmages\
PHOTO ID2	6n(2).jpg

	\Images\wright01 6n.jpg	DIGITAL PHOTO ID3
2	\Images\wright01 6n(2).jpg	DIGITAL PHOTOID4

\Images\wright016n(3).jpg
\Images\wright016n(4).jpg

STREET #	16				
DIRECTION	S			and the state	
STREET	WRIGHT			A.C. C.	Contraction of the second
SUFFIX	ST				
PIN	0818318003		a she and		
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon Listed on existing	N C ndary structure				
SURVEY?	Local District	, NR District		and the second of the second of the	A HARRISON AND A HARRING AN
			GENERAL INFO	DRMATION	
CATEGORY b	uilding		CURRENT FUNCTION	Domestic - multiple dv	velling
CONDITION g	ood		HISTORIC FUNCTION	ON Domestic - single dwe	lling
INTEGRITY	ninor alterations	and addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached ga	age			
	Ŧ		ARCHITECTURA	L DESCRIPTION	
ARCHITECTURA CLASSIFICATIO		n		PLAN	rectangular
DETAILS				NO OF STORIES	2.5
BEGINYEAR	c. 1925			ROOF TYPE	Side gable
OTHER YEAR	0. 1020			ROOF MATERIAL	Asphalt - shingle
DATESOURCE	surveyor			FOUNDATION	Concrete
WALL MATERIA		Brick		PORCH	Front entry
WALL MATERIA		DIICK		WINDOW MATERI	AL Wood
WALL MATERIA		Brick		WINDOW MATERL	AL
WALL MATERIA		DIICK		WINDOW TYPE	double hung/fixed
WALL MATERIA	IL 2 (01 Igilial)			WINDOW CONFIG	4/1; 1-light
			rns; front gable entry porch ung windows & half circle w		uare brick columns on solid
	Front porch ex story rear addit		n steps, wrought iron suppo	rts and porch railing; 2nd e	ntry added under porch; 2

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; side driveway; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
16 S WRIG	GHT

DIGITAL	∖Images∖wr	
PHOTO ID	6s.jpg	
DIGITAL	\Images\wr	
PHOTO ID2	6s(2).jpg	

	\Images\wright01 6s.jpg	DIGITAL PHOTO ID3
2	\Images\wright01 6s(2).jpg	DIGITAL PHOTOID4

\Images\wright016s(3).jpg
\Images\wright016s(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	20				7-	1/	-
DIRECTION	N				-je	2	
STREET	WRIGHT		1	Can co			
SUFFIX	ST						The second s
PIN	0818312002		100				
LOCAL SIGNIFICANCE RATING	NC				1.4		
POTENTIAL IND NR? (Y or N)	Ν		and the second s				
Contributing to a NR DISTRICT?	NC						
Contributing secon	dary structure	? NC	- 10				
Listed on existing SURVEY?	Local District;	NR District	6 4	a sussed		e shares a contract	
			(GENERAL INF	ORM	IATION	
CATEGORY bu	uilding			CURRENT FUNCT	ION	Domestic - single dwelli	ng
CONDITION go	ood			HISTORIC FUNCT	ION	Domestic - single dwelli	ng
INTEGRITY m	INTEGRITY major alterations and/or addition(s) REASON for SIGNFICANCE						
SECONDARY STRUCTURE	Detached gar	age					
	_		AR	CHITECTURA	L D	ESCRIPTION	
ARCHITECTURA CLASSIFICATION		(altered)				PLAN	rectangular
DETAILS		· · · ·]	NO OF STORIES	2
BEGINYEAR	c. 1925					ROOF TYPE	Side gable
OTHER YEAR	0. 1020					ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor					FOUNDATION	Not visible
WALL MATERIA		Brick				PORCH	Side entry
WALL MATERIA		aluminum				WINDOW MATERIA	L Wood
WALL MATERIA		Brick				WINDOW MATERIA	
WALL MATERIA	-					WINDOW TYPE	double hung
	- (B)	L				WINDOW CONFIG	1/1
SIGNIFICANT FEATURES	South side entr	y porch with sq	uare bri	ck piers and gable ro	oof; fro	ont gable sun porch	

ALTERATIONS Original house obscured by alterations and additions--replacement windows in altered openings on north side, original openings on rest of house; 2nd story addition (not historic); aluminum under eaves Replacement of existing siding with fiber cement board, replacement of soffit and fascia (admin. approved COA#15-2805)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
20 N WRI	ЭНТ

\lmag 0n.jpg
\lmag 0n(2).

)	\Images\wright02 0n.jpg	DIGITAL PHOTO ID3
02	\Images\wright02 0n(2).jpg	DIGITAL PHOTOID4

\Images\wright020n(3).jpg
\Images\wright020n(4).jpg

STREET #	21			C C C C C C C C C C C C C C C C C C C		A MARA (12 Maral 1		
DIRECTION	Ν			A REAL				
STREET	WRIGHT		te	Alexand	H.			
SUFFIX	ST					and the second s		
PIN	0818311006		4 -	Not All	//			
LOCAL SIGNIFICANCE RATING	С		A					
POTENTIAL IND NR? (Y or N)	Ν						1	
Contributing to a NR DISTRICT? Contributing secon	C dary structure?	NC					MALLINIT.	
Listed on existing SURVEY?	Local District;							
			(GENERAL INFO	ORN	IATION		
CATEGORY bu	uilding			CURRENT FUNCTION	ON	Domestic - multiple dwe	ellin	g
CONDITION go	ood			HISTORIC FUNCTION	ON	Domestic - single dwelli	ng	
INTEGRITY m	ajor alterations	and/or addition(s))	REASON for SIGNFICANCE				
SECONDARY STRUCTURE	Detached gar	age		SIGNFICANCE				
ARCHITECTURA	L		<u>A</u> R	RCHITECTURAL	L D		:	agular
CLASSIFICATION	Gabled El					PLAN NO OF STORIES	2	egular
DETAILS								ulti-gable
BEGINYEAR	c. 1880-90)				ROOF TYPE		phalt - shingle
OTHER YEAR						ROOF MATERIAL	L	one/concrete
DATESOURCE	Surveyor					FOUNDATION		ont entry
WALL MATERIA	L (current)	Aluminum				WINDOW MATERIA		Wood
WALL MATERIA	L 2 (current)					WINDOW MATERIA		
WALL MATERIA	L (original)	Wood				WINDOW MATERIA WINDOW TYPE		double hung
WALL MATERIA	L 2 (original)					WINDOW CONFIG		1/1
SIGNIFICANT FEATURES	House was orig	jinally gabled ell, w	vith f	ront gable and south s	side (
	2 story rear add		h ado	dition; window appear		porch with 2 entry doors historic wood replacem		onversion to multi-family); t windows

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
Ş	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
21 N WRI	GHT

DIGITAL	\Image
PHOTO ID	1n.jpg
DIGITAL	\Image
PHOTO ID2	1n(2).j

)	\Images\wright02 1n.jpg	DIGITAL PHOTO ID3
2	\Images\wright02 1n(2).jpg	DIGITAL PHOTOID4

\Images\wright021n(3).jpg
\Images\wright021n(4 0.jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	21		2.6				100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100
DIRECTION	S		X	1.XVII-			and the second
STREET	WRIGHT		X	K. Kunta			3
SUFFIX	ST		X				- VIMANKE,
PIN	0818317011			A A A			1 Alton
LOCAL SIGNIFICANCE RATING	С						
POTENTIAL IND NR? (Y or N)	N		K				
Contributing to a NR DISTRICT?	С						
Contributing second	dary structure	? C		H H			
Listed on existing SURVEY?	Local District;	NR District					and the second second
				GENERAL INF	ORN	IATION	
CATEGORY bu	ilding			CURRENT FUNCT	ION	Domestic - single dwel	ling
			ION	Domestic - single dwel	ling		
INTEGRITY mi	nor alterations	and addition(s)		REASON for SIGNFICANCE			
SECONDARY STRUCTURE	Detached gar	age					
			A	RCHITECTURA	LD	ESCRIPTION	
ARCHITECTURAL CLASSIFICATION		Foursquare				PLAN	rectangular
	American	Toursquare				NO OF STORIES	2.5
DETAILS	4000					ROOF TYPE	Hipped
BEGINYEAR C. 1920				ROOF MATERIAL	Asphalt - shingle		
OTHER YEAR]	FOUNDATION	concrete/not visible		
DATESOURCE	Surveyor	Driek				PORCH	Full front
WALL MATERIAI		Brick Stucco				WINDOW MATERIA	L Wood

WALL MATERIAL (original)

WALL MATERIAL 2 (original)

Hipped roof with overhanging eaves and front hipped dormer; full front porch with square brick columns on solid knee walls; projecting entry bay; historic 3/1 and 1-light wood windows; stucco and brick exterior

WINDOW MATERIAL

Double hung/awning/case

3/1; 1-light

WINDOW TYPE

WINDOW CONFIG

SIGNIFICANT

FEATURES

ALTERATIONS Replacement dormer windows; replacement door; rear porch enclosed

Brick

Stucco

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees; side driveway



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
21 S WRI	ЭНТ

DIGITAL	\Image
PHOTO ID	1s.jpg
DIGITAL	\lmage
PHOTO ID2	1s(2).j

)	\Images\wright02 1s.jpg	DIGITAL PHOTO ID3
2	\Images\wright02 1s(2).jpg	DIGITAL PHOTOID4

\Images\wright021s(3).jpg

\Images\wright021(4). jpg

STREET #	22			A	1 1	× • /	(.,
DIRECTION	S						
STREET	WRIGHT		A.L.	3000			
SUFFIX	ST						
PIN	0818318004					e	
LOCAL SIGNIFICANCE RATING	NC						
POTENTIAL IND NR? (Y or N)	N						
Contributing to a NR DISTRICT?	NC						
Contributing secon	dary structure	? NC	AVI		_		
Listed on existing SURVEY?	Local District;	NR District		fille age		- And -	
			,	GENERAL INFO	RN	<u>AATION</u>	
CATEGORY b	uilding			CURRENT FUNCTIO	ON	Domestic - single dwelli	ng
CONDITION e	xcellent			HISTORIC FUNCTION	ON	Domestic - single dwelli	ng
INTEGRITY major alterations and/or addition(s) REASON for							
	SIGNFICANCE						
SECONDARY STRUCTURE	Detached gar	age					
ARCHITECTURAL DESCRIPTION ARCHITECTURAL DESCRIPTION PLAN rectangular							
CLASSIFICATIO	N No Style (altered)				NO OF STORIES	2
DETAILS							
BEGINYEAR	c. 1900					ROOF TYPE	Front gable
OTHER YEAR						ROOF MATERIAL	Asphalt - shingle
DATESOURCE	surveyor					FOUNDATION	Stone
WALL MATERIA	L (current)	Wood				PORCH	- L Wood
WALL MATERIA	L 2 (current)					WINDOW MATERIA	
WALL MATERIA	L (original)	Wood				WINDOW MATERIA	
WALL MATERIA	L 2 (original)					WINDOW TYPE WINDOW CONFIG	double hung/fixed multi-light
SIGNIFICANT FEATURES	Front gable roc	of; 2 story gable s	outh	side bay with 1st story	cuta		man-ngnt
				; one story front entry b al window on front faça			lacement windows in original

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees





DIGITAL	\
PHOTO ID	2
DIGITAL	\I
PHOTO ID2	2

)	\Images\wright02 2s.jpg	DIGITAL PHOTO ID3
02	\Images\wright02 2s(2).jpg	DIGITAL PHOTOID4

\Images\wright022s(3).jpg
\Images\wright021s(4).jpg

STREET #	25				
DIRECTION	S				
STREET	WRIGHT				
SUFFIX	ST				
PIN	0818317012			TET	
LOCAL SIGNIFICANCE RATING POTENTIAL IND	PS				
NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	С			25	
Contributing second	lary structure:	P NC			
Listed on existing SURVEY?	Local District;	NR District	All the second second		
			GENERAL INFO	DRMATION	
CATEGORY bu	ilding		CURRENT FUNCTION	ON Domestic - single dwel	ling
CONDITION go	od		HISTORIC FUNCTION	ON Domestic - single dwel	ling
INTEGRITY mi	nor alterations	and addition(s)			ence from the turn of the 20th
	SIGNFICANCE century.				
SECONDARY STRUCTURE	Detached gar	age			
ARCHITECTURA	L		ARCHITECTURA	L DESCRIPTION PLAN	rectangular
CLASSIFICATION	No Style				
DETAILS				NO OF STORIES	2
BEGINYEAR	c. 1905			ROOF TYPE	Multi-gable
OTHER YEAR				ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor			FOUNDATION	Stone
WALL MATERIAI	L (current)	Wood - shingle		PORCH	Full front
WALL MATERIAI	L 2 (current)			WINDOW MATERIA	
WALL MATERIAI	L (original)	Wood - shingle		WINDOW MATERIA	
WALL MATERIAI	L 2 (original)	Wood		WINDOW TYPE	double hung
	_	L		WINDOW CONFIG	1/1
			outh side gables; shed roof double hung windows on no		olumns; stained glass window
ALTERATIONS F	Replacement 1	/1 double hung wi	indows on front and north e	levations (historic); 1 story	rear porch addition

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees; rear wrought iron fence



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
25 S WRI	GHT

DIGITAL	\Images\wr
PHOTO ID	5s.jpg
DIGITAL	\Images\wr
PHOTO ID2	5s(2).jpg

\Images\wright02	DIGITAL
5s.jpg	PHOTO ID3
\Images\wright02	DIGITAL
5s(2).jpg	PHOTOID4

\Images\wright025s(3).jpg
\Images\wright025s(4

).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	27	Les 17		ally in the case					
DIRECTION	Ν	X A		Sty JE					
STREET	WRIGHT	AT Via							
SUFFIX	ST								
PIN	0818311005	XIX							
LOCAL SIGNIFICANCE RATING	NC								
POTENTIAL IND NR? (Y or N)	Ν								
Contributing to a NR DISTRICT? Contributing secon	NC dary structure? NC								
Listed on existing SURVEY?	Local District; NR District			Listed on existing					
	· · · · ·	GENERAL INFOR	MATION						
CATEGORY bu	uilding	GENERAL INFOR		ling					
	uilding		Domestic - single dwel						
CONDITION ex		CURRENT FUNCTION	Domestic - single dwel						
CONDITION ex	cellent	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel						
CONDITION (ex) INTEGRITY (not SECONDARY STRUCTURE	Detached garage	CURRENT FUNCTION HISTORIC FUNCTION REASON for	Domestic - single dwel						
CONDITION (e) INTEGRITY (no SECONDARY STRUCTURE ARCHITECTURA	L	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel						
CONDITION (e) INTEGRITY (nd SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION	L	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel Domestic - single dwel Domestic - single dwel DESCRIPTION	ling					
CONDITION EXAMPLE CONDITION EXAMPLE CONDARY INTEGRITY no SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	L N N N N N N N N N N N N N N N N N N N	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel	ling					
CONDITION (e) INTEGRITY (not SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS BEGINYEAR	L	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel	ling irregular 2.5					
CONDITION EXAMPLE CONDITION EXAMPLE CONDARY INTEGRITY no SECONDARY STRUCTURE ARCHITECTURA CLASSIFICATION DETAILS	L N N N N N N N N N N N N N N N N N N N	CURRENT FUNCTION HISTORIC FUNCTION REASON for SIGNFICANCE	Domestic - single dwel	irregular 2.5 Multi-gable					

WALL MATERIAL (current) WALL MATERIAL 2 (current)

WALL MATERIAL (original)
WALL MATERIAL 2 (original)

FOUNDATION C PORCH F WINDOW MATERIAL WINDOW MATERIAL

WINDOW MATERIAL WINDOW TYPE WINDOW CONFIG

Aluminum

casement

Multi-light

SIGNIFICANT	
FEATURES	
LITTORES	
ALTERATIONS	

Stucco/Wood - vertical board

Stucco/Wood - vertical board

Stone veneer

Stone veneer

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Southwest corner of Franklin and Wright; front and north sidewalks; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
27 N WRI	ЭНТ

DIGITAL	\lm
PHOTO ID	7n.
DIGITAL	∖lm
PHOTO ID2	7n(

)	\Images\wright02 7n.jpg	DIGITAL PHOTO ID3
02	\Images\wright02 7n(2).jpg	DIGITAL PHOTOID4

\Images\wright027n(3).jpg
\Images\wright027n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	28	the second of the		
DIRECTION	Ν	W.	A	A
STREET	WRIGHT	1		
SUFFIX	ST			
PIN	0818312001			
LOCAL SIGNIFICANCE RATING	С			
POTENTIAL IND NR? (Y or N)	Ν			
Contributing to a NR DISTRICT? Contributing second	C dary structure? C			
Listed on existing				
SURVEY?	Local District; NR District	and the second	and i growth	
		GENERAL INFO	RMATION	
CATEGORY bu	ilding	CURRENT FUNCTIO	N Domestic - multiple dw	relling
CONDITION ex	cellent	HISTORIC FUNCTIO	N Domestic - single dwel	ling
INTEGRITY mi	nor alterations	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached garage			
		ARCHITECTURAL	DESCRIPTION	
ARCHITECTURA CLASSIFICATION	r			
			PLAN	Rectangular
	American Foursquare	lassia	PLAN NO OF STORIES	Rectangular 2.5
DETAILS	American Foursquare Queen Anne - Free Cl	lassic		
DETAILS BEGINYEAR	American Foursquare	lassic	NO OF STORIES	2.5
DETAILS BEGINYEAR OTHER YEAR	American Foursquare Queen Anne - Free Cl c. 1905	lassic	NO OF STORIES ROOF TYPE	2.5 Hipped
DETAILS BEGINYEAR	American Foursquare Queen Anne - Free Cl c. 1905 Surveyor	lassic]]	NO OF STORIES ROOF TYPE ROOF MATERIAL	2.5 Hipped Asphalt - shingle

WALL MATERIAL 2 (current) WALL MATERIAL (original)

WALL MATERIAL 2 (original)

SIGNIFICANT FEATURES

Flared hipped roof with overhanging eaves and front and north hipped roof dormers; 3-sided two story south side bay with pedimented roof; historic 1/1 and diamond light wood windows; square north side window bay

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

Wood

1/1; diamond

double hung/casement

ALTERATIONS Porch partially enclosed on south end (not historic)

Wood

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
Fra	utheast corner of Wright and anklin; front sidewalk; rear /eway; similar setbacks; mature es
COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE





DIGITAL	\Images\wright02	DIGITAL	\Images\wright028n(3
PHOTO ID	8n.jpg	PHOTO ID3).jpg
DIGITAL	\Images\wright02	DIGITAL	\Images\wright028n(4
PHOTO ID2	8n(2).jpg	PHOTOID4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

capitals make this a distinctive local example of the

American Foursquare.

STREET #	31	S		
DIRECTION	S			
STREET	WRIGHT	12		
SUFFIX	ST			
PIN	0818317013			
LOCAL SIGNIFICANCE RATING	S		n	
POTENTIAL IND NR? (Y or N)	Ν			
Contributing to a NR DISTRICT? Contributing secon	C dary structure? NC			
Listed on existing SURVEY?	Local District; NR District	same and		
GENERAL INFORMATION				
CATEGORY bu	uilding	CURRENT FUNCTION	ON Domestic - single dwelling	
CONDITION ex	kcellent	HISTORIC FUNCTION	ON Domestic - single dwelling	
INTEGRITY a	ddition(s)	REASON for	The ceramic tile roof and Prairie detailing on the porch	

SIGNFICANCE

SECONDARY	
STRUCTURE	

RUCTURE

Detached garage

ARCHITECTURAL DESCRIPTION

ARCHITECTURA CLASSIFICATIO			PLAN	rectangular	
CLASSIFICATIO	American	rouisquale		NO OF STORIES	2.5
DETAILS	Prairie			Llippod	
BEGINYEAR	c. 1910			ROOF TYPE	Hipped
				ROOF MATERIAL	Ceramic Tile
OTHER YEAR				FOUNDATION	Concrete
DATESOURCE	Surveyor			PORCH	Full front
WALL MATERIAL (current) Brick				WINDOW MATERIA	L Wood/beveled glass
WALL MATERIAL 2 (current)				T Al	
WALL MATERIAL (original)		Brick		WINDOW MATERIA	L Aluminum
				WINDOW TYPE	double hung/single hung
WALL MATERIAL 2 (original)			WINDOW CONFIG	1/1	
FEATURES	Hipped roof with overhanging eaves; front and side hipped dormers; broad massing; full porch with brick columns & knee walls; historic wood windows on main house; beveled glass windows; first story square window bay on south elevation				
ALTERATIONS	Two story rear addition; replacement windows (not historic) in dormers				

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Northwest corner of Wright and Van Buren; front and south sidewalks; rear driveway; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
31 S WRI	GHT

DIGITAL	\Images
PHOTO ID	1s.jpg
DIGITAL	\Images
PHOTO ID2	1s(2).jp

I	\Images\wright03 1s.jpg	DIGITAL PHOTO ID3
2	\Images\wright03 1s(2).jpg	DIGITAL PHOTOID4

\Images\wright031s(3).jpg
\Images\wright031s(4).jpg

STREET #	32				
DIRECTION	S		U.X MAL		
STREET	WRIGHT		Ker Kert		
SUFFIX	ST		VER HEAL		
PIN	0818318005		VIL WILL		
LOCAL SIGNIFICANCE RATING	С		A AND		
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT? Contributing second	C				
Listed on existing SURVEY?	Local District; NR D	Pistrict		Mar Min S	
			GENERAL INFO	RMATION	
CATEGORY bu	ilding		CURRENT FUNCTION	DN Domestic - single dwell	ling
CONDITION ex	cellent		HISTORIC FUNCTION	ON Domestic - single dwell	ling
INTEGRITY ma	ajor alterations and/c	or addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached garage				
		AI	RCHITECTURAI	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION				PLAN	irregular
DETAILS				NO OF STORIES	2
BEGINYEAR	c.1900			ROOF TYPE	Multi-gable
OTHER YEAR	0.1300			ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor			FOUNDATION	Stone
WALL MATERIAI		4		PORCH	Wrap around
WALL MATERIA		d - shingle		WINDOW MATERIA	L Wood
WALL MATERIA	`´´	0		WINDOW MATERIA	
WALL MATERIA	-	d - shingle		WINDOW TYPE	Double hung/single hung
		a shingle		WINDOW CONFIG	1/1
SIGNIFICANT FEATURES	Front gable bay with	pent enclosure;	2 story side gable north	n and south bays with 1st st	ory cutaway corners
c	ppenings (historic); 1 instillation of stone v	story south side	addition (not historic); ation of the addition to r	nt porch (not historic); replace rear deck and screen porch match original foundation (a val COA#14-4087) Addition	n addition (not historic) dmin. approved COA#10-1640)
(HPC approval COA	416-942) Additio		lows, new porch ráils & spir	ndles, alteration to style of existing

HISTORIC NAME				
COMMON NAME				
COST				
ARCHITECT				
ARCHITECT	2			
BUILDER				
ARCHITECT SOURCE				
HISTORIC INFO				
PERMITS				
LANDSCAPE Northeast corner of Wright and Van Buren; front and south sidewalks; rear alley; similar setbacks; mature trees				



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
32 S WRI	GHT

DIGITAL	∖In
PHOTO ID	2s
DIGITAL	\In
PHOTO ID2	2s

•	\Images\wright03 2s.jpg	DIGITAL PHOTO ID3
02	\Images\wright03 2s(2).jpg	DIGITAL PHOTOID4

\Images\wright032s(3).jpg
\Images\wright032s(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	103		1				
DIRECTION	Ν				Y		AR
STREET	WRIGHT		X	N A A A	X		
SUFFIX	ST		1	ANKAN	e		N MA
PIN	0818308017		in the second se		V.		A think of
LOCAL SIGNIFICANCE RATING	С						
POTENTIAL IND NR? (Y or N)	Ν						
Contributing to a NR DISTRICT?	С		W				
Contributing secon	dary structure	? NC		- Annald State		a los la	
Listed on existing SURVEY?	Local District	; NR District					
			<u>(</u>	GENERAL INFO	ORN	IATION	
CATEGORY bu	uilding			CURRENT FUNCTION	ON	Domestic - single dwelli	ng
CONDITION ex	cellent			HISTORIC FUNCTION	ON	Domestic - single dwelli	ng
INTEGRITY major alterations and/or addition(s) REASON for SIGNFICANCE							
SECONDARY STRUCTURE	Detached ga	rage					
	_		AR	RCHITECTURAI	L D	ESCRIPTION	
ARCHITECTURA CLASSIFICATION		II (altered)				PLAN	irregular
DETAILS	Queen A					NO OF STORIES	2
BEGINYEAR	c. 1885					ROOF TYPE	Multi-gable
OTHER YEAR						ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor					FOUNDATION	Stone/concrete
WALL MATERIA		Wood				PORCH	Front entry
WALL MATERIAL 2 (current) Wood - shingle					WINDOW MATERIA	L Vinyl	
WALL MATERIAL (original) Wood					WINDOW MATERIA		
WALL MATERIAL 2 (original)					WINDOW TYPE	double hung	
······································					WINDOW CONFIG	6/6	
SIGNIFICANT FEATURES							

ALTERATIONS House has been recently renovated---replacement front porch & door; large 2 story rear/south add.; 2 story north add.; 1 story extension of original south side bay; replacement siding; replacement windows; 2nd story bay window on front gable

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Northwest corner of Franklin and Wright; front and south sidewalks; rear driveway; similar setbacks; mature trees





COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
103 N WRI	GHT

DIGITAL	∖lr
PHOTO ID	3r
DIGITAL	∖Ir
PHOTO ID2	3r

)	\Images\wright10 3n.jpg	DIGITAL PHOTO ID3	
02	\Images\wright10 3n(2).jpg	DIGITAL PHOTOID4	

\Images\wright103n(3).jpg
\Images\wright103n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	104		+		
DIRECTION	S				
STREET	WRIGHT				
SUFFIX	ST				
PIN	0818323001				
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	S N				
Contributing to a NR DISTRICT? Contributing second	NR DISTRICT?				
-				A State of the second second	
Listed on existing SURVEY?	Local District; NR District	a state a printing the state		Sector Contraction Contraction	
		GENERAL INFORM	MATION		
CATEGORY bu	ilding	CURRENT FUNCTION	Domestic - single dwel	ling	
CONDITION go	ood	HISTORIC FUNCTION	Domestic - single dwelling		
INTEGRITY	SIGNFICANCE cha			estantial Free-Classic Queen Anne residence, with racteristic pent gable roof and classically ornamented	
SECONDARY STRUCTURE	Detached garage	por			
ARCHITECTURAL DESCRIPTION					
ARCHITECTURA CLASSIFICATION			PLAN	rectangular	
			NO OF STORIES	2.5	
DETAILS			ROOF TYPE	Front gable	
BEGINYEAR	c. 1900		ROOF MATERIAL	Asphalt - shingle	
OTHER YEAR			- FOUNDATION	Stone	
DATESOURCE	surveyor L (current) Wood - shingle		PORCH	Wrap around	

WALL MATERIAL 2 (current)

Wood

WALL MATERIAL (original)

WALL MATERIAL 2 (original)

SIGNIFICANT FEATURES Front gable roof with pent enclosure; 2 story north and south bays with 1st story cutaway corners and pent gable roofs; wraparound front porch w/ lonic columns & dentil trim; historic 1/1 double hung wood windows

WINDOW MATERIAL

WINDOW MATERIAL

WINDOW TYPE

WINDOW CONFIG

Wood

Leaded glass

1/1; 1-light

double hung/fixed/caseme

ALTERATIONS Replacement wood shingle siding (not historic); 1 story rear porch addition Replacement of siding with cement boards replacement of windows with aluminum clad windows, restore original balusters on front porch (admin. approval COA#13-2034) In kind shingle replacement (admin. approval COA#18-3267) In kind porch replacement (admin. approval COA#19-926) Second story addition to rear (HPC approval COA#18-2255)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Southeast corner of Wright & Van Buren; front and north sidewalks; side lot (south); rear driveway/alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
104 S WRIG	GHT

DIGITAL	\Images\wright	
PHOTO ID	4s.jpg	
DIGITAL	\Images\wright	
PHOTO ID2	4s(2).jpg	

\Images\wright10	DIGITAL
4s.jpg	PHOTO ID3
\Images\wright10	DIGITAL
4s(2).jpg	PHOTOID4

\Images\wright104s(3).jpg
\Images\wright104s(4).jpg

STREET #	105				
DIRECTION	S		AV.	A MAN	
STREET	WRIGHT		A COL		I and I
SUFFIX	ST				
PIN	0818322009				
LOCAL SIGNIFICANCE RATING POTENTIAL IND NP2 (V or N)	C				
NR? (Y or N) Contributing to a NR DISTRICT? Contributing second Listed on existing SURVEY?	С				
			GENERAL INFO	<u>DRMATION</u>	
CATEGORY bu	iilding		CURRENT FUNCTION	ON Domestic - single dwel	ling
CONDITION go	ood		HISTORIC FUNCTION	ON Domestic - single dwel	ling
INTEGRITY ma	ajor alterations	and/or addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached gar	age]		
		A	RCHITECTURA	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION				PLAN	irregular
DETAILS				NO OF STORIES	2
BEGINYEAR	c. 1880			ROOF TYPE	Multi-gable
OTHER YEAR	c. 1900-10	0		ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Surveyor	<u> </u>		FOUNDATION	Stone/concrete block
WALL MATERIA		Wood		PORCH	Front (enclosed)
WALL MATERIA		Wood - shingle		WINDOW MATERIA	AL Wood
WALL MATERIAL (original) Wood - shingle		WINDOW MATERIA			
WALL MATERIA	L 2 (original)	Wood		WINDOW TYPE	Double hung/single hung
SIGNIFICANT FEATURES	Front gable bay	y; south cross gable;	3-sided window bay	WINDOW CONFIG	1/1
			storicroofline altered/ra rear addition; north entr	aised); dormer addition; inse y addition (not historic)	et porch (historiclater

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Southwest corner of Wright and Van Buren; front and north sidewalks; rear driveway; similar setbacks;
	mature trees
COA DATE	
COA	
DECISION	



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
105 S WRIG	GHT

DIGITAL \\mages\wright10		DIGITAL	\Images\wright105s(3		
PHOTO ID 5s.jpg		PHOTO ID3).jpg		
DIGITAL	\Images\wright10	DIGITAL	\Images\wright105s(4		
PHOTO ID2	5s(2).jpg	PHOTOID4).jpg		

STREET #	107					
DIRECTION	Ν					
STREET	WRIGHT					
SUFFIX	ST					
PIN	0818308016					
LOCAL SIGNIFICANCE RATING	NC					
POTENTIAL IND NR? (Y or N)	Ν				BINH	
Contributing to a NR DISTRICT?	NC	? NC				
Contributing second	dary structure					
Listed on existing SURVEY?	Local District	NR District				
			GENERAL INFO	RMATION		
CATEGORY bu	uilding		CURRENT FUNCTIO	N Domestic - single dwell	ing	
CONDITION excellent			HISTORIC FUNCTIO	ON Domestic - single dwelling		
INTEGRITY not altered REASON for SIGNFICANCE						
SECONDARY STRUCTURE	Detached gar	age				
	_		ARCHITECTURAL	DESCRIPTION		
ARCHITECTURA CLASSIFICATION		itional		PLAN	rectangular	
DETAILS				NO OF STORIES	2.5	
BEGINYEAR	c. 2000			ROOF TYPE	Hipped	
OTHER YEAR	0. 2000			ROOF MATERIAL	Asphalt - shingle	
DATESOURCE	Surveyor			FOUNDATION	Stone	
WALL MATERIA		Wood		PORCH	Full front	
WALL MATERIA		Wood - shingle		WINDOW MATERIA	L vinyl	
		Wood		WINDOW MATERIA	L Wood/Beveled glass	
WALL MATERIAL 2 (original)			WINDOW TYPE	Double hung/fixed/awning		
	- (B)	L		WINDOW CONFIG	1/1; 1-light	

SIGNIFICANT FEATURES	
ALTERATIONS	

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees; rear fencing



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
107 N WRI	ЭНТ

DIGITAL	∖lma(
PHOTO ID	7n.jp
DIGITAL	\lmag
PHOTO ID2	7n(2)

)	\Images\wright10 7n.jpg	DIGITAL PHOTO ID3
02	\Images\wright10 7n(2).jpg	DIGITAL PHOTOID4

\Images\wright107n(3).jpg
\Images\wright107n(4).jpg

STREET #	111		N 11		851		19007	
DIRECTION	S		AY	NAME			依	THE PARTY OF
STREET	WRIGHT		XIX	XE			R	WY IT
SUFFIX	ST		W				L.	
PIN	0818322010			16	/			WYY =
LOCAL SIGNIFICANCE RATING	C							KV/
POTENTIAL IND NR? (Y or N)	Ν							
Contributing to a NR DISTRICT?	С							CHAR CONT
Contributing second	ndary structure	? C		and the second				
Listed on existing SURVEY?	Local District	NR District					-	
			G	ENERAL INFO)RN	IATION		
CATEGORY b	uilding			CURRENT FUNCTIO	ON [Domestic - single dwelli	ng	
CONDITION g	ood]	HISTORIC FUNCTION	ON	Domestic - single dwelli	ng	
INTEGRITY	ninor alterations	and addition(s)		REASON for SIGNFICANCE				
SECONDARY STRUCTURE	Detached gar	age						
			AR	CHITECTURAI	L DI	ESCRIPTION		
ARCHITECTURA CLASSIFICATIO		ont				PLAN	Re	ctangular
DETAILS						NO OF STORIES	2	
BEGINYEAR	c. 1905					ROOF TYPE	Fro	ont gable
OTHER YEAR	0. 1000					ROOF MATERIAL	As	phalt - shingle
DATESOURCE	Surveyor					FOUNDATION	Co	ncrete - block
WALL MATERIA		Wood				PORCH	Fu	Il front
WALL MATERIA						WINDOW MATERIA	L	Wood
WALL MATERIA		Wood				WINDOW MATERIA	L	
WALL MATERIA	-					WINDOW TYPE		double hung
		L]	WINDOW CONFIG		1/1; 3/1
SIGNIFICANT FEATURES	Front gable roc	of with wood frieze	e; histo	ric 1/1 wood windows	S			
ALTERATIONS	Front porch en	closed (c. 1920);	two sto	ory rear addition; doo	r add	ed (now enclosed) to so	outh	side; rear deck addition

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
111 S WRI	GHT

DIGITAL	\
PHOTO ID	1
DIGITAL	\
PHOTO ID2	1

)	\Images\wright11 1s.jpg	DIGITAL PHOTO ID3
02	\Images\wright11 1s(2).jpg	DIGITAL PHOTOID4

\Images).jpg	\wright111s(3
\Images).jpg	\wright111s(4

STREET #	115				
DIRECTION	N				All the to all the
STREET	WRIGHT				
SUFFIX	ST				Y MAY
PIN	0818308015	I			
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	S				
Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	C				
			GENERAL INFO	ORMATION	
CATEGORY b	uilding		CURRENT FUNCTION		ling
	ood		HISTORIC FUNCTIO		-
	ninor alteration	6		-	
SIGNFICANCE many original features, including projecting front gable					
SECONDARY STRUCTURE	Detached ga	rage		porch.	
ARCHITECTURAL DESCRIPTION					
ARCHITECTURA CLASSIFICATIO		in Bungalow		PLAN	rectangular
				NO OF STORIES	1
DETAILS	a 1020			ROOF TYPE	Side gable
BEGINYEAR	c. 1920			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR	surveyor			FOUNDATION	Not visible
DATESOURCE WALL MATERIA		Brick		PORCH	Front
WALL MATERIA		Stucco		WINDOW MATERIA	AL Wood
		Brick		WINDOW MATERIA	
WALL MATERIAL (original) Brick WALL MATERIAL 2 (original) Stuco		WINDOW TYPE double hu		double hung/fixed/awning	
WALL MATERIA	L 2 (original)	01000		WINDOW CONFIG	1/1; 9/1; multi-light
SIGNIFICANT FEATURESBroad side gable roof with overhanging eaves & exposed rafter tails; front gable porch w/ brick knee wall; historic 9/1 single hung wood windows under porch & 1/1 wood windows on side elevations; historic wood door; nested side gable bay on north side					
ALTERATIONS	front window u	Inder porch gable p	painted roof replacement (a	dmin. approval COA#11-33	371)

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
street	lock on west side of residential t; front sidewalk; rear alley; ar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
115 N WRI	GHT

DIGITAL	\lı
PHOTO ID	5ı
DIGITAL	\lı
PHOTO ID2	5ı

D	\Images\wright11 5n.jpg	DIGITAL PHOTO ID3
D2	\Images\wright11 5n(2).jpg	DIGITAL PHOTOID4

\Images\wright115n(3).jpg
\Images\wright115n(4).jpg

City of NAPERVILLE ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 115

STREET S. WRIGHT STREET

ADDITIONAL PHOTOS OR INFORMATION

Alterations

Replacement siding (historic); wrought iron railing and concrete steps (not historic); fixed shutters (not historic); replacement 1/1 aluminum windows under gable (not historic); 3-sided south bay addition (historic); 1 story rear addition; replacement windows in original openings (historic); one story front bay and porch additions (not historic)

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	115			Section 199	111		et al la la	
DIRECTION	S			All I	J.	NA MA	X	Te y
STREET	WRIGHT		J. Sala	A Company	1	Mar - Cost	L JETTY	
SUFFIX	ST		S.V.C		A			ALA TO
PIN	0818322011				1			VE //
LOCAL SIGNIFICANCE RATING	С							
POTENTIAL IND NR? (Y or N)	Ν							
Contributing to a NR DISTRICT?	С		1.		ī.			
Contributing secon	dary structure	? NC			in in Salare		- Lake	S MA HE
Listed on existing SURVEY?	Local District	; NR District						August & Mar & Market
			GEN	NERAL INFO)RM	ATION		
CATEGORY bu	uilding		CUI	RRENT FUNCTI	ON [Domestic - single dwell	ng	
CONDITION go	bod		HIS	TORIC FUNCTI	ON [Domestic - single dwell	ng	
INTEGRITY m	inor alterations	3		ASON for NFICANCE				
SECONDARY STRUCTURE	Detached gai Shed (NC)	rage						
	_		ARCH	ITECTURA	L DI	ESCRIPTION		
ARCHITECTURA CLASSIFICATION		ont Cottage				PLAN	rectangular	
DETAILS						NO OF STORIES	1.5	
BEGINYEAR	c. 1900					ROOF TYPE	Front gable	
OTHER YEAR	c. 1920					ROOF MATERIAL	Asphalt - sh	ingle
DATESOURCE	Surveyor					FOUNDATION	Concrete - t	block
WALL MATERIA		Wood				PORCH	Front	
WALL MATERIA		11000				WINDOW MATERIA	L Wood	
WALL MATERIA		Wood				WINDOW MATERIA	L Aluminur	n
WALL MATERIA	-	WOOd				WINDOW TYPE	double h	ung
WALL WATCHA	L 2 (UI Igilial)					WINDOW CONFIG	8/1;6/1;	4/1
SIGNIFICANT FEATURES	Front gable roo	of; historic 6/1; 8	/1; and 4/1	wood windows				

ALTERATIONS Replacement siding (historic); wrought iron railing and concrete steps (not historic); fixed shutters (not historic); replacement 1/1 aluminum windows under gable (not historic); 3-sided south bay addition (historic)---SEE CONTINUATION SHEET

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	

LANDSCAPE Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
115 S WRI	GHT

\lma 5s.jp
\lma 5s(2

)	\Images\wright11 5s.jpg	DIGITAL PHOTO ID3
02	\Images\wright11 5s(2).jpg	DIGITAL PHOTOID4

\Images\wright115s(3).jpg
\Images\wright115s(4).jpg

STREET #	116		21		KI CAY
DIRECTION	S				1 AL
STREET	WRIGHT		Star the		
SUFFIX	ST		A AF		
PIN	0818323002				
LOCAL SIGNIFICANCE RATING	S				
POTENTIAL IND NR? (Y or N)	Ν				
Contributing to a NR DISTRICT?	С				
Contributing secon Listed on existing SURVEY?		? C	Ser Contraction		
			GENERAL INFO	DRMATION	
CATEGORY b	uilding		CURRENT FUNCTION	ON Domestic - single dwel	ling
CONDITION g	ood		HISTORIC FUNCTION	ON Domestic - single dwel	ling
INTEGRITY m	INTEGRITY minor alterations and addition(s) REASON for Early, transitional Colonial Revival residence with Queen				
SECONDARY STRUCTURE	Detaolieu galage				
			ARCHITECTURA	L DESCRIPTION	
ARCHITECTURA CLASSIFICATIO		Revival		PLAN	Т
				NO OF STORIES	1.5
DETAILS	Queen Ar	ine		ROOF TYPE	Multi-gable
BEGINYEAR	c. 1900			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR	Surveyor			FOUNDATION	Stone
DATESOURCE WALL MATERIA		Wood		PORCH	Front
WALL MATERIA		wood		WINDOW MATERIA	AL Wood
WALL MATERIA		Wood		WINDOW MATERIA	
WALL MATERIA		wood		WINDOW TYPE	double hung
WALL MAIERIA	IL 2 (original)			WINDOW CONFIG	1/1
FEATURES		toric 1/1 wood wi	and cornice returns; rounden ndows; front porch with rour		ay; Palladian window under d knee wall (may be historic,
ALTERATIONS		ont porch (historio may be historic)	c); new entry in front gable b	oay (historic); 3-part front wir	ndow added to front façade

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
	Midblock on east side of residential street; front sidewalk; rear alley; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
116 S WRI	GHT

DIGITAL	\Image
PHOTO ID	6s.jpg
DIGITAL	\Image
PHOTO ID2	6s(2).j

)	\Images\wright11 6s.jpg	DIGITAL PHOTO ID3
02	\Images\wright11 6s(2).jpg	DIGITAL PHOTOID4

\Images\wright116s(3).jpg
\Images\wright116s(4).jpg

City of NAPERVILLE ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY CONTINUATION SHEET

STREET # 119

STREET N. WRIGHT STREET

ADDITIONAL PHOTOS OR INFORMATION

Alterations

S. side addition between bays with interior stair & new entry (may be historic); replacement front porch (historic); 2 story rear addition; replacement windows on south gable and on 3rd floor under front gable (not historic); aluminum siding on 1st story and on rear addition (not historic); fixed shutters (not historic)

STREET #	119		I I WE Y	Self [PUNECK	ţ1]	
DIRECTION	Ν		the state	校旗			
STREET	WRIGHT			A XP			and the second second
SUFFIX	ST			XX		_	at Page to the
PIN	0818308014						
LOCAL SIGNIFICANCE RATING	С		AXAT	2		-	
POTENTIAL IND NR? (Y or N)	Ν			- 10			
Contributing to a NR DISTRICT? Contributing secon	C	С					
Listed on existing SURVEY?	Local District; N						
			GENERAL INF	ORMA	Γ ΙΟΝ		
CATEGORY bu	uilding		CURRENT FUNCT	ION Dom	nestic - single dwell	ing	
CONDITION go							
INTEGRITY m	inor alterations a	and addition(s)	REASON for				
			SIGNFICANCE				
SECONDARY STRUCTURE	Detached garage	ge					
ARCHITECTURA			ARCHITECTURA			rec	tangular
CLASSIFICATION	N Gabled Ell			PLAN rectangul NO OF STORIES 2.5			
DETAILS	Queen Ann	е					
BEGINYEAR	c. 1890				ROOF TYPE Multi-gable		phalt - shingle
OTHER YEAR					OOF MATERIAL		<u> </u>
DATESOURCE	DATESOURCE Surveyor				OUNDATION	Stone/concrete block Full front	
WALL MATERIA	L (current)	Nood			ORCH	L	
WALL MATERIA	L 2 (current)	Aluminum			INDOW MATERIA	L	Wood
WALL MATERIA	L (original)	Wood			INDOW MATERIA	L	Leaded glass
WALL MATERIA	L 2 (original)				INDOW TYPE	L	double hung/fixed
SIGNIFICANT FEATURES	Front gable and	side gable ell wi	th cutaway corners; histor		INDOW CONFIG		1/1; 2/2 ade of front gable bay
\$	ALTERATIONS S. side addition between bays with interior stair & new entry (may be historic); replacement front porch (historic); 2 story rear addition; replacement windows on south gable and on 3rd floor under front gable (not historic)SEE CONTINUATION SHEET						

HISTORIC NAME	
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
HISTORIC INFO	
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; rear alley; stone gate at rear; similar setbacks; mature trees



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
119 N WRI	ЭНТ

DIGITAL	\Ir
PHOTO ID	9r
DIGITAL	\lr
PHOTO ID2	9r

)	\Images\wright11 9n.jpg	DIGITAL PHOTO ID3
02	\Images\wright11 9n(2).jpg	DIGITAL PHOTOID4

\Images\wright119n(3).jpg	
\Images\wright119n(4).jpg	

STREET #	119				THE TANK
DIRECTION	S			1	
STREET	WRIGHT				LANCE
SUFFIX	ST				1 AM
PIN	0818322012				
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N)	C N				
Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	C dary structure Local District;				
			<u>GENERAL INFO</u>	DRMATION	
CATEGORY bu	uilding		CURRENT FUNCTION	ON Domestic - single dwe	lling
CONDITION go	bod		HISTORIC FUNCTI	ON Domestic - single dwe	lling
INTEGRITY m	inor alterations	and addition(s)	REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached gar	rage			
			ARCHITECTURA	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION		1		PLAN	irregular
				NO OF STORIES	1.5
DETAILS	1922			ROOF TYPE	Front gable
BEGINYEAR	1922			ROOF MATERIAL	Asphalt - shingle
OTHER YEAR	Owner			FOUNDATION	Concrete
DATESOURCE WALL MATERIA		Wood		PORCH	-
WALL MATERIA		Wood - vertical b	oard	WINDOW MATERIA	AL Wood
WALL MATERIA		Stucco		WINDOW MATERIA	AL Vinyl/glass block
WALL MATERIA				WINDOW TYPE	double hung/casement
	L 2 (original)			WINDOW CONFIG	3/1; 2/1; 4/1
	Front gable roc side dormer	of with overhangin	g eaves; front gable bay; h	istoric 4/1, 3/1, & 2/1 windov	ws on side elevations; north
				was originally stuccoed); re asement windows; rear dec	placement windows on front k addition (1990s)

HISTORIC NAME	Hedinger, John House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT	2
BUILDER	
ARCHITECT SOURCE	
INFO	According to owner, John Hedinger first came to Naperville in 1914 and worked as a cement layer.
PERMITS	
LANDSCAPE	Midblock on west side of residential street; front sidewalk; side driveway; similar setbacks; mature trees





COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
119 S WRI	GHT

DIGITAL PHOTO ID	ļ
DIGITAL	Ì
PHOTO ID2	9

)	\Images\wright11 9s.jpg	DIGITAL PHOTO ID3
02	\Images\wright11 9s(2).jpg	DIGITAL PHOTOID4

\Images\wright119s(3).jpg
\Images\wright119s(4).jpg

STREET #	125			CANT	
DIRECTION	N				X
STREET	WRIGHT		and when the state		1 . 1
SUFFIX	ST				the second secon
PIN	0818308013		12		And Constants
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing second Listed on existing					
SURVEY?	IHSS (O); Lo	cal District; NR			
			<u>GENERAL INFO</u>	DRMATION	
CATEGORY bu	ilding		CURRENT FUNCTION	ON Domestic - single dwel	ling
CONDITION ex	cellent		HISTORIC FUNCTION	ON Domestic - single dwel	ling
INTEGRITY no	t altered		REASON for SIGNFICANCE		
SECONDARY STRUCTURE	Detached gar Shed(NC)	rage			
	r		ARCHITECTURA	L DESCRIPTION	
ARCHITECTURAL CLASSIFICATION				PLAN	rectangular
DETAILS				NO OF STORIES	2.5
BEGINYEAR	1906			ROOF TYPE	Side gable
OTHER YEAR	c. 1930			ROOF MATERIAL	Asphalt - shingle
DATESOURCE	Owner			FOUNDATION	concrete
WALL MATERIAI	L (current)	Wood		PORCH	Wrap around
WALL MATERIAI		wood - shingle		WINDOW MATERIA	
WALL MATERIAI	L (original)	Wood		WINDOW MATERIA	
WALL MATERIAI	L 2 (original)	Wood - shingle		WINDOW TYPE	Double hung/awning
FEATURES	ladding (histo	ric alt); 1 story, 3-s	sided south bay; historic fro		1/1; 1-light
ALTERATIONS V	vrap around po	orch (not historic2	2000)		

HISTORIC NAME		
COMMON NAME		
COST		
ARCHITEC		
ARCHITEC	2	
BUILDER		
ARCHITEC SOURCE		
HISTORIC INFO	According to the owners, Mrs. Lillian Priem, who lived in the house from 19222 to 1960, was the first female chemistry professor at NCC.	
PERMITS	See continuation sheet for photograph of historic front entry. According to owners, the roof was originally hipped, & reconfigured in the 1930s during a 2- flat conversion. The cedar siding also dates from that time.	
LANDSCAP	E Midblock on west side of residential street; front sidewalk; rear alley; similar setbacks; mature trees	



COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/8/2007
SURVEYAREA	NAPERVILLE
125 N WRI	GHT

DIGITAL	\I
PHOTO ID	5
DIGITAL	\I
PHOTO ID2	5

)	\Images\wright12 5n.jpg	DIGITAL PHOTO ID3
02	\Images\wright12 5n(2).jpg	DIGITAL PHOTOID4

\Images\wright125n(3).jpg
\Images\wright125n(4).jpg

ILLINOIS URBAN ARCHITECTURAL AND HISTORICAL SURVEY

STREET #	126			2
DIRECTION	Ν			a de
STREET	WRIGHT			19
SUFFIX	ST		14	1
PIN	0818309002			
LOCAL SIGNIFICANCE RATING POTENTIAL IND NR? (Y or N) Contributing to a NR DISTRICT? Contributing secon Listed on existing SURVEY?	S N C dary structure? - IHSS (O); Local District; NR			
		GENERAL INFO	DIMATION	
	uilding	CURRENT FUNCTION		
CONDITION go	bod	HISTORIC FUNCTI	ON Domestic - single dwelli	ng
INTEGRITY	inor alterations and addition(s)	REASON for SIGNFICANCE	Despite alterations, this impr house remains a significant	
SECONDARY STRUCTURE				
	_	ARCHITECTURA	L DESCRIPTION	
ARCHITECTURA CLASSIFICATION			PLAN	irregular
DETAILS			NO OF STORIES	2.5
	c. 1915		ROOF TYPE	Side gable
BEGINYEAR OTHER YEAR	C. 1915		ROOF MATERIAL	Asphalt - shingle
	Surveyor		FOUNDATION	Not visible
DATESOURCE	-		PORCH	Wrap around
WALL MATERIA			WINDOW MATERIA	L Wood
			WINDOW MATERIA	L Glass block
WALL MATERIA	-		WINDOW TYPE	casement/double hung/fixe
WALL MATERIA			WINDOW CONFIG	1/1; 1-light
	Side gable roof with shed dormowindows	ers and copper gutters; wrap	paround porch with square br	ick piers; historic 1/1 wood

ALTERATIONS Replacement windows in dormers; glass block in center dormer; exterior stair on south side; one story rear addition on north side connected with 140 N. Wright.

HISTORIC NAME	Kroehler, P. E. House
COMMON NAME	
COST	
ARCHITECT	
ARCHITECT2	2
BUILDER	
ARCHITECT SOURCE	
INFO L	NR]P. E. Kroehler was Naperville ounge Factory Co.'s president beginning in 1903.
PERMITS	
LANDSCAPE	Midblock on east side of residential street; house set far back on lot, almost in center of block; curving front driveway; mature trees





COA DATE	
COA DECISION	
PREPARER	Lara Ramsey
PREPARER ORGANIZATION	GRANACKI HISTORIC CONSULTANTS
SURVEYDATE	11/7/2007
SURVEYAREA	NAPERVILLE
126 N WRI	ЭНТ

DIGITAL	\Images\wright12	DIGITAL
PHOTO ID	6n.jpg	PHOTO ID3
DIGITAL	\Images\wright12	DIGITAL
PHOTO ID2	6n(2).jpg	PHOTOID4

\Images\wright126n(3).jpg
\Images\wright126n(4).jpg